

# aiwa

AIWA CO.,LTD. UTSUNOMIYA FACTORY

2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

## SERVICE TECHNICAL INFORMATION

### ONE POINT REPAIR

UTSUNOMIYA, MAY 18 1995

REF. NO. : SI-95-011  
CUSTOMER RELATION & SERVICE DIV.


MODEL : AM-F1

SUBJECT : "Caution" during play/record

CONTENTS: Due to a faulty thread system in the AM - F1 model. "Caution" appears during play-record.

SYMPTOM : Caution is indicated during play/record, or 5~6 seconds after start play back. Also, the set can not work when placed on stand the set (input/output terminal facing up).

REMEDY : Repair by following the steps below.

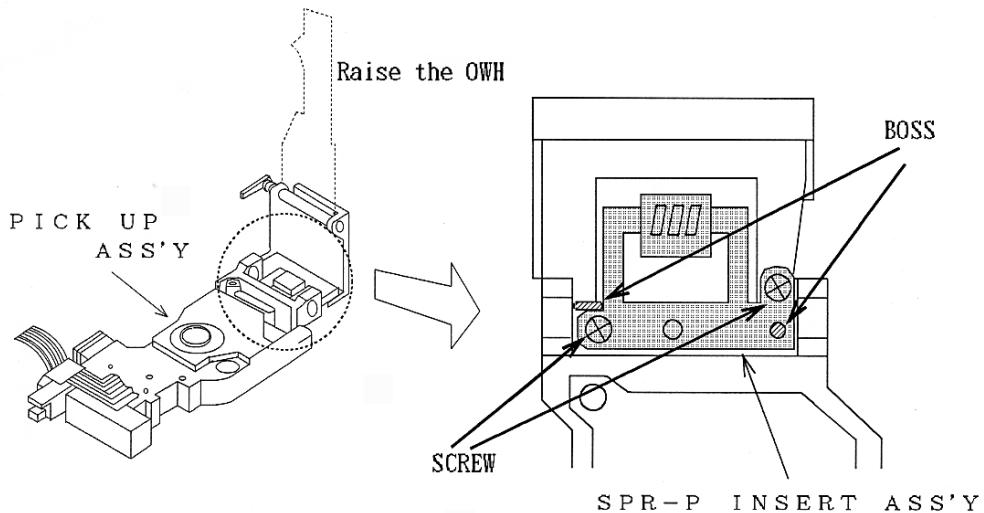

- (1) Disassemble the set and remove the PICK UP ASSY. (Always short the short round of the PICK UP flexible wire.)
- (2) Remove the faulty SPR-P INSERT ASSY from the PICK UP ASSY.
- (3) Insert a new SPR-P INSERT ASSY between the two bosses and secure with screws.

**Note:** If the SPR-P INSERT ASSY is secured with screws after being incorrectly inserted between the bosses, it may become deformed and the above symptoms will recur. Pay careful attention when inserting the SPR-P INSERT ASSY.

Ref.	Parts Name	Parts No.
—	SPR-P, INSERT ASSY	87-046-415-010