

**aiwa**

**AIWA CO., LTD  
UTSUNOMIYA FACTORY**  
2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

## SERVICE TECHNICAL INFORMATION

## ONE POINT REPAIR

UTSUNOMIYA, APRIL 20, 1998


REF. NO.: SI-98-001

## **CUSTOMER RELATIONS & SERVICE DIV.**

MODEL : AM-F5  
SUBJECT : The equipment stops suddenly during playback or recording. When power is turned on, NO ADJ is displayed but the equipment does not operate.  
DESCRIPTION : It may happen that during playback or recording, the equipment suddenly stops, displays "NO ADJ" thereafter, and rejects the operation keys or when power is turned on, the equipment displays "NO ADJ" but does not operate at all. If these occurs , take the following countermeasure.  
Countermeasures : To make the power circuit stable, exchange Q602 and Q603 with the following parts.

| Ref.      | Part Name | Part No.       |
|-----------|-----------|----------------|
| Q602,Q603 | DTC143 TE | 87-A30-222-040 |

Reference : The old parts used were DTC114E.

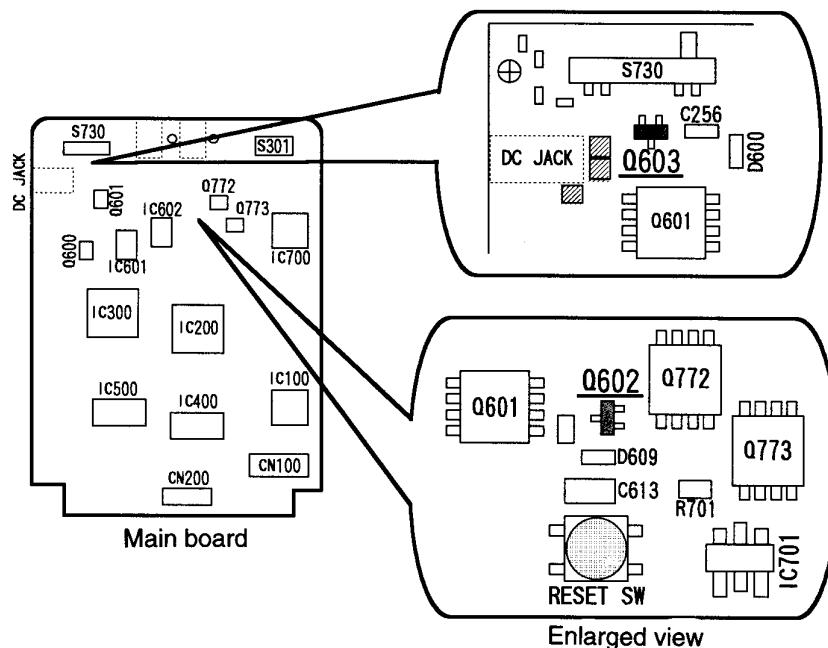

## Part layout drawing

Memo: When NO ADJ is displayed on the LCD, the equipment rejects the operation keys unless it is adjusted. Exchange the parts and then adjust the equipment according to the adjustment method described in the adjustment mode field of the service manual.