

aiwa

AIWA CO., LTD
UTSUNOMIYA FACTORY
2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-2116, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, APR. 15, 1999
REF. NO.: SI-98-052
CUSTOMER RELATIONS & SERVICE DIV.

MODEL : AM-HX30 D, AEZ, AK, AHK, AHR
AM-ST40 AEZ, AHK, D

SUBJECT : Notes on removing C.B and replacing pickups

CONTENTS : Double-sided adhesive tape is used to place FFC from the pickup on the main C.B of the listed models. If a C.B of the models is removed for repairing, place the pickup FFC again using a new piece of double-sided adhesive tape. Failure in correct handling of the pickup FFC may interfere with the movement of a pickup on innermost radius of the disk. It may cause error in reading TOC, indicating "DISC ERROR."

Placing pickup FFC: Cut double-sided adhesive tape into a 7mm-by-5mm piece, and place it onto the pickup FFC. Place the pickup FFC on the back side of C.B, avoiding a twist.

* Do not reuse a piece of removed adhesive tape again.

