

Service Technical Information

MODEL NO.	AM-HX50 / HX55
SUBJECT	Noise heard on headphones during playback operation

REF.No. :G - A0 - 042 - E0

DATE :29. JUN. 2000

<CONTENTS>


The models concerned may produce low-level noises with volume at minimum position.
The noises occur in synchronization with blinks of OPE LED, approximately 8 seconds after starting playback operation.
Take the following action against the problem.



Main unit OPE LED

<COUNTERMEASURE>

Change the values from 100 μ H to 180 μ H on L600 in the power supply section.

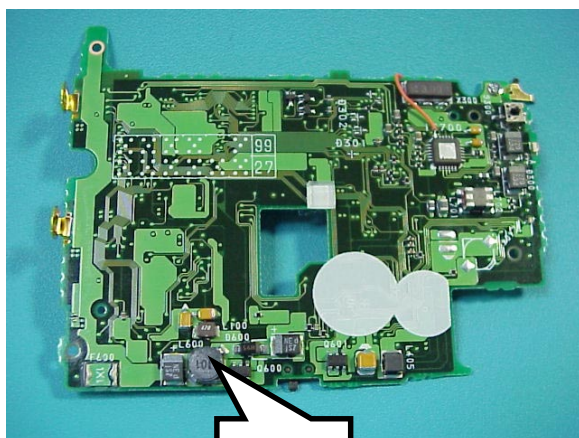

L600

MAIN C.B. mechanism section

