

# aiwa

AIWA CO., LTD  
UTSUNOMIYA FACTORY  
2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

## SERVICE TECHNICAL INFORMATION

### ONE POINT REPAIR

UTSUNOMIYA, OCTOBER 15, 1997  
REF. NO.: SI-97-034  
CUSTOMER RELATIONS & SERVICE DIV.

 
MODEL : DX-Z9450M

SUBJECT : No screen display

DESCRIPTION : The above model may have a defect which causes no display being shown.  
Take the following action against the problem.


REMEDIES : TAITSU-product or NISSEI-product mylar capacitors C361 & C362  
(0.027μF/50V) are employed in the PT PWB. Replace TAITSU capacitors  
with NISSEI capacitors regardless of presence/absence of the above problem.  
\* Manufacturer-name indication on capacitors:

TAITSU product:






A circle "O" is  
printed on the product.

 NISSEI product:



A character "N" is  
printed on the product.

 PT C.B Pattern side

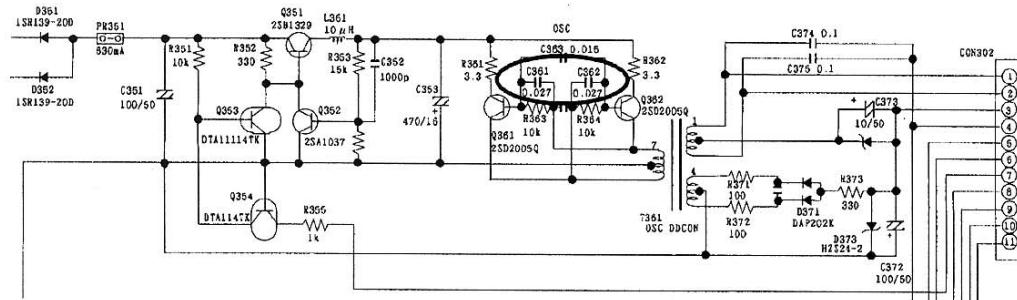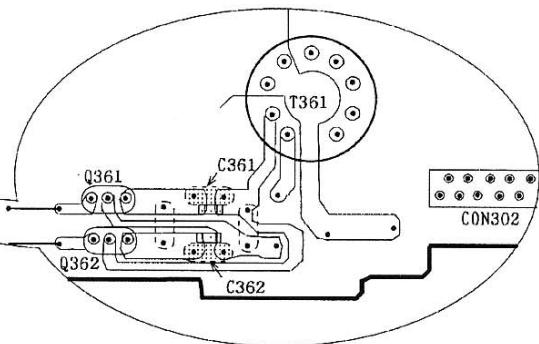

#### [Memo]

\* Serial numbers of units in question: S03PJ75\*\*\*\*\* through S03PJ77\*\*\*\*\*

\* A unit on which the modification has already been performed is marked with a dot "\*" on  
package printing and serial number label.

Ref. No.	Part name	Part code
C361/362	CAP M 0.027-50J	88-700-890-010