

aiwa

**AIWA CO.,LTD
UTSUNOMIYA FACTORY**
2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR


UTSUNOMIYA, OCTOBER 15, 1996

REF. NO. : SI-96-032

CUSTOMER RELATIONS & SERVICE DIV.

MODEL : NSX-E5M
SUBJECT : Does not read CD TOC, does not play
SYMPTOM : Occassionally the CD TOC is not read, or the set does not play. If such a problem is indicated by the customer, perform the following remedy.

REMEDY : 1) Replace the R 6 18KΩ with an 8.2 KΩ.
2) Replace the R12 27KΩ with a 10 KΩ.
3) Replace the C22 3300PF with a 1200PF.
4) Remove the R46 2.7 KΩ.
5) Remove the C566 0.47μF/50V.

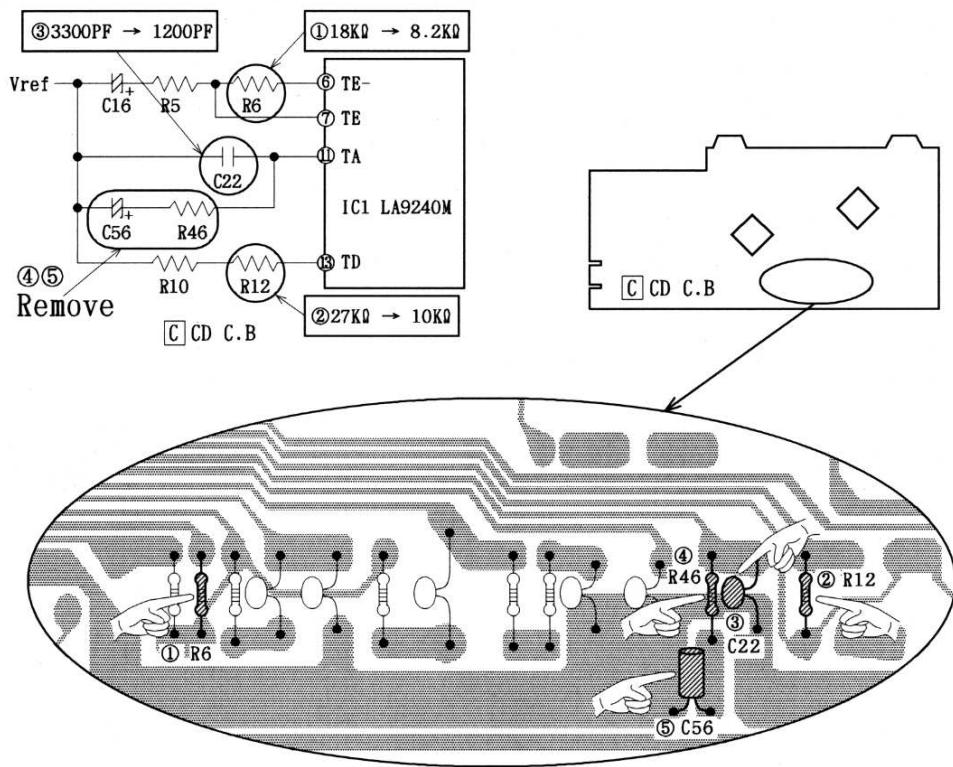

Part No.	Part Name	Ref. No.
88-121-822-080	RES, 8.2K Ω	R6
88-121-103-080	RES, 10K Ω	R12
87-014-059-010	CAP, SER 1200PF	C22