



Service Bulletin

No. : MZ08-073

Date: December 16, 2008

Model: CD5003

Subject: Software Update Information

Symptom: When Digital sound recording of the MD deck of SONY (MDS-JB930), the sound recording of MD is started first and CD5003 is playback, DIGUNLOCK indicates, 1 or 2 seconds of the beginning recorded on the MD are missing.

Solution: 1. The u-P software needs to be updated. The new version number after the correction is [Ver. 2008-06-25-C]. The part number for the update data is: **00M06DW499A04**

For the update procedure, please refer to the CD5003 Service Manual on Page 8, **"6. UPDATE MICROPROCESSOR SOFTWARE PROCEDURE"**.

Before the update, check the firmware version number first. (See the Service Manual on Page 6, '[A] SERVICE MODE').

Parts:

00M06DW499A04 (File name: **CD5003_080625_C.s24**) PROGRAM DATA FOR IC51 of MAIN PWB.

Serial Number Range:

MZ0008xx002120 All units after this (MZ0008xx002121~) have already corrected on the production lines.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.