



Service Bulletin

No. : MZ03-015

Date: December 7, 2006

Model: CD5400

Subject: Noise when playback Mix CD Mute problem during TOC reading.

Symptom: 1. Noise is heard when you fast rewind from Audio track to the Data track with a Mixed CD. 2. Music of the first track will be heard for a moment when you move the Pitch control up/down during TOC reading.

Solution: Replace the MPU IC (IC71: TMP87PS71AF) to the new version.

Parts:

Ref#	Description	Part Number
IC71	TMP87PS71AF	*HU100660R

Serial Number Range:

All units where symptoms are observed.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.