



## Service Bulletin

No. : MZ00-007

Date: November 29, 2006

---

**Model:** CD6000, CD6000OSE

**Subject:** Recorded CD-R disc can not be playback.

**Symptom:** Some recorded CD-R discs cannot be played back because the CD player does not detect the CD-R disc.

**Solution:** Add a 10pF, 50V NP0 capacitor to location reference #2509 on the HF AMP PCB.

### Parts:

Ref#	Description	Part Number
2509	10pf 50V NPO 0805 Capacitor	DD91100300

### Serial Number Range:

This modification applies to product which has above mentioned phenomenon only. This modification was not applied during production.

---

### CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.