



Service Bulletin

No. : MZ05-004

Date: January 10, 2007

Model: CD6000, CD6000F

Subject: Cannot Playback hybrid Super Audio CD (CD portion)

Symptom: Can not playback the CD portion of a hybrid Super Audio CD.
"ERROR" is indicated on the display when attempting to playback the CD section.

Solution: The following 4pcs have been changed on the HF AMP CIRCUIT BOARD:


1. Ref. # 3504 CHIP RESISTOR (22K OHM) is changed to (18K OHM).
2. Ref. # 3505 CHIP RESISTOR (10K OHM) is added.
3. Ref. # 2510 CHIP CAPACITOR (10pF 50V) is added.
4. Ref. # 2509 CHIP CAPACITOR (10pF 50V) is removed.

Parts:


Ref#	Description	Part Number
3504	CHIP RESISTOR 18k OHM +-1% 1/10W	00MNI01183110
3505	CHIP RESISTOR 10k OHM +-1% 1/10W	00MNI01103110
2510	CHIP CAPACITOR 10pF 50V	00MDD51100300

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

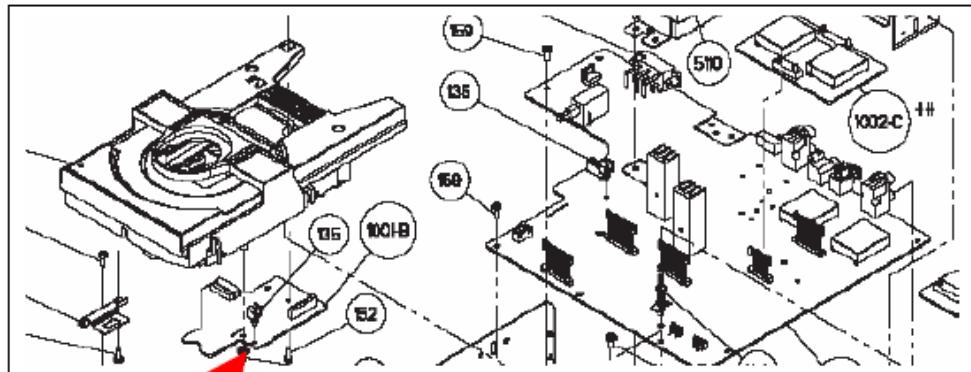


HF AMP CIRCUIT BOARD

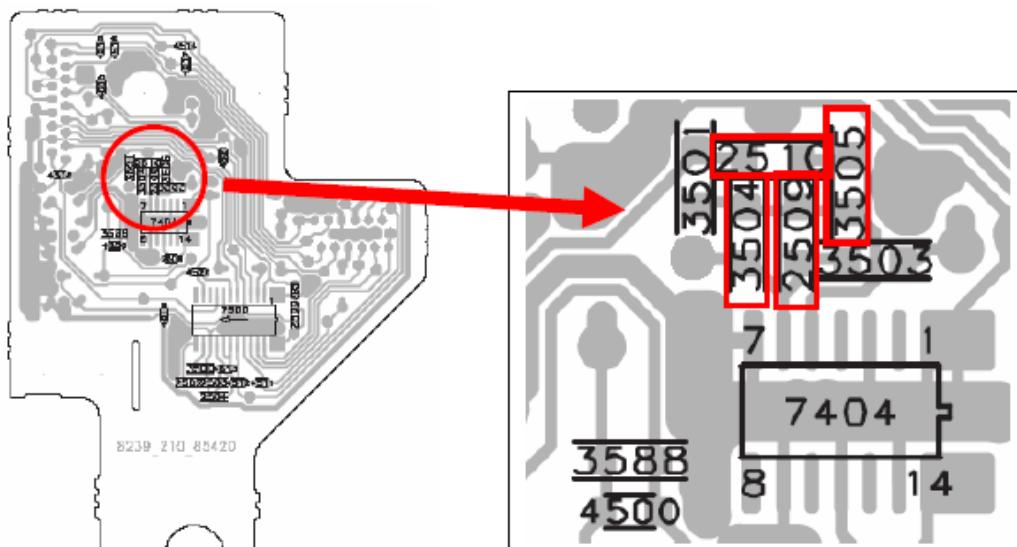

Attention:

After you change the 4 parts if a CD-RW Disc cannot be Played back, please change the CHIP RESISTOR shown to a **"0 OHM Jumper"**.

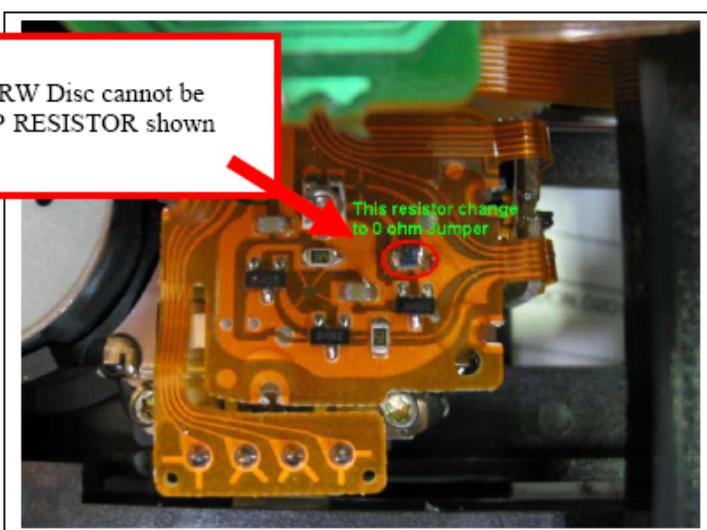

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.