

marantz®

SERVICE BULLETIN

Level

Application:

★ ★

See below

Date: 18-July.-2006

Model: PM4001/PM4001F

Page: 1 / 1

REF.NBR: MZ06-027

Subject:

Improvement of Reliability

(Change the voltage endurance of the capacitor.)

Int.ref:

[REASONS]




Under conditions of over voltage etc., the capacitors C901, C902 or C903 may be shorted and the thermal fuse of the power transformer will be blown.

[SOLUTION]

POS.NO. C901, C902, C903 (CER CAP. 0.1uF 50V ZF) are changed (FILM CAP 0.1uF 100V) on the INPUT & AMPLIFIER PWB.

[NECESSARY PART]

OLD NEW	POS.NO.	PART NO. (FOR EUR)	PART NO. (MZ)	PART NAME	DESCRIPTION	FACTORY CODE NO
OLD	C901 C902 C903	nsp	nsp	CER CAP.	0.1uF 50V ZF	CCFT1H104ZF
NEW	C901 C902 C903	00MDF15104550	00MDF15104550	FILM CAP	0.1uF 100V	CCME2A104JXT

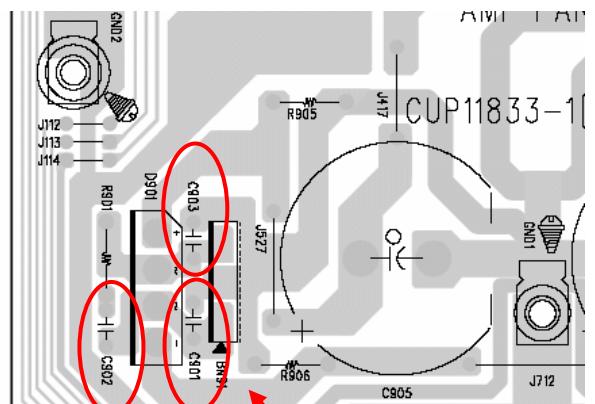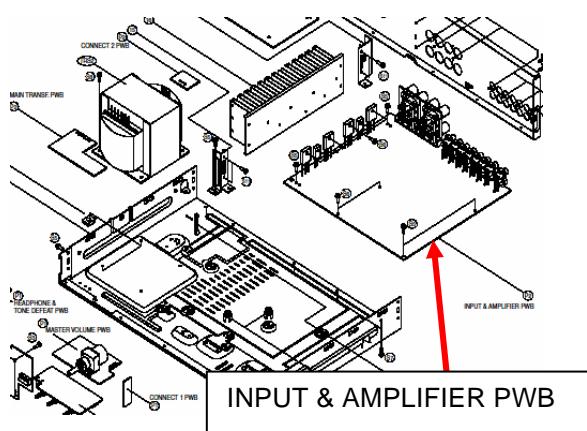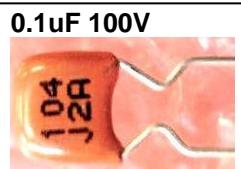

C901, C902, C903

Approved by N.Sensui

Written by S.NAGAO

WQ-19 2 817/additional rule 3 (1st Issue 2003-03-19)

[REMARKS]

1. This problem apply to the following serial number.

1) **PM4001/N1B apply to MZ0106xx007130 and earlier.**

This improvement has been done in the production serial number **MZ0106xx007131 and after.**

2) **PM4001/N1S apply to MZ0106xx006550 and earlier.**

This improvement has been done in the production serial number **MZ0106xx006551 and after.**

3) **PM4001/N1G apply to MZ0106xx000965 and earlier.**

This improvement has been done in the production serial number **MZ0106xx000966 and after.**

4) **PM4001F (PM4001 OSE)/N1B apply to MZ0106xx001000 and earlier.**

This improvement has been done in the production serial number **MZ0106xx001001 and after.**

5) **PM4001F(PM4001 OSE)/N1S apply to MZ0106xx001460 and earlier.**

This improvement has been done in the production serial number **MZ0106xx001461 and after.**