

<b>marantz®</b> <b>SERVICE BULLETIN</b>		Date: 17-Jul.-2002	Model: PM4200
		Page: 1/2	REF.NBR: MZ02-009revision
Subject:			Problem with incorrect operation of MUTE.
			Int.ref:
Circulation:	Application:		
<input checked="" type="checkbox"/> for information customer complaint in case of service mandatory .....	See below		

### [PHENOMENON]

The MUTE LED sometimes blinks and the sounds from output intermit.

### [CAUSE]

Contact error between the bracket (Pos. No. 30) and the ground of INPUT/AMPLIFIER PCB (Pos. No. 29).

### [SOLUTION]

#### (Revision)

**Repair work was changed. This work is done without removing a circuit board.**

Contact to the ground certainly by the wire with the lug.

Please refer to the processing figure of the next page and correct.

### [NECESSARY PART]

The wire with the lug: (MJI Part No. YB00091620 or similar product)



### [REMARKS]

This improvement has been done in the production line after.

The serial number MZ000149006651 and later. (PM4200/N1B/N2B)

The week code number MZxx0203xxxxxx and later. (PM4200/N1G/N2G)

Processing figure (Part side view)

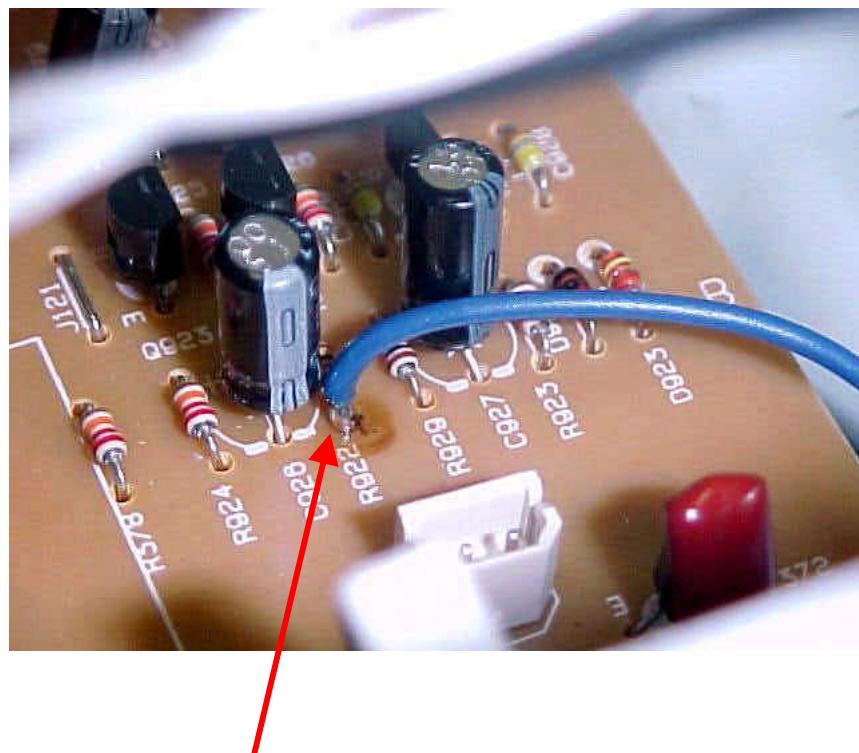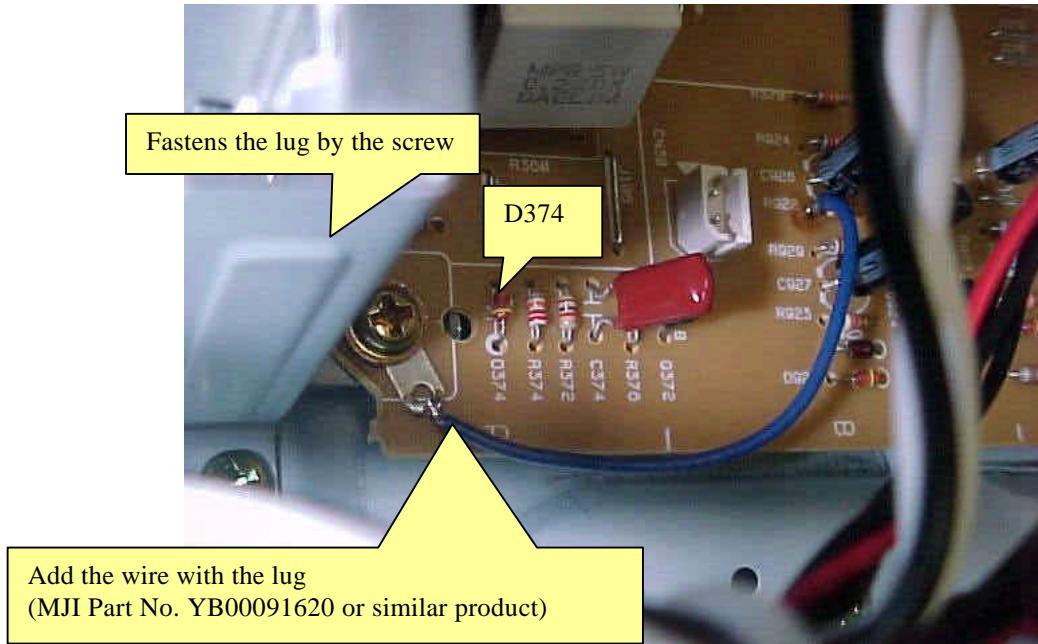

**Solder the wire to the ground side lead of the R922 or R929**