



Service Bulletin

No. : MZ09-028

Date: May 21, 2009

Model: PM5003

Subject: Improvement of the DC protection circuit

* This Service Bulletin is only service information for units displaying the symptom and needing the following minor improvement. This is not a call for rework and it need not be applied to stock units.

Symptom: If the Amplifier breaks down, a DC voltage may be output from the speaker terminals.

Solution: The value of the DC protection circuit of "INPUT PWB" and "AMPLIFIER PWB" has been changed.

Change the parts listed below to the new values.

Parts:

| Ref Nr. | Parts Number | After the modification | Before the modification |
|-----------|--------------|------------------------|-------------------------|
| R381, 382 | nsp | 68k ohms 1/6W | 33k ohms 1/6W |
| R922, 926 | nsp | Delete | 1k ohms 1/6W |
| R924 | nsp | 1k ohms 1/6W | 22k ohms 1/6W |
| C926 | nsp | 47uF/25V | 22uF/25V |

Serial Number Range:

All

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.