



Service Bulletin

No. : MZ09-120

Date: November 17, 2009

Model: PM5003

Subject: Correction of distortion deterioration of SPK output.

Countermeasure is applicable only upon claim from the customer.

Symptom: The distortion of the speaker output deteriorates when the volume is up at "SOURCE DIRECT", and a specific level is exceeded.

Reason: The preamp oscillates due to the small capacity of C409/410 causing the preamp to become unstable.

Solution: We changed capacitor C409/410 from 10pF to 100pF.

Parts:

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
C409/410	10pf CERAMIC Capacitor	NSP	100pf, CERAMIC Capacitor	NSP

Serial Number Range:

Please apply the above modification to the production models in the following serial numbers.

MZ000941001100

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.