



Service Bulletin

No. : MZ02-001

Date: December 4, 2006

Model: SA8260

Subject: At times a CD can not be played a second time.

Symptom: At times a CD can not be played a second time.

Solution: Replace the microprocessor (QF01) on the PV16 SERVO PWB. The version changes to V0.42 from V0.36, V0.39 and V0.41.

This problem was improved in Ver0.41 but please change to V0.42 which is the most recent version. Ver0.42 has incorporated additional improvements not found in earlier updates.

Note: Confirm the version number of the microprocessor before replacement. The version number can be confirmed in service mode.

1. To enter Service mode: While pressing <OPEN/CLOSE> and <Track skip (forward)> buttons plug in the AC cord.
2. < Track skip (forward)> button is pressed.
3. The version of (QF01) u-COM "Ver. X.XX " is displayed.

Serial Number Range:

The improvement (Ver0.41) has been done in production after Lot number "MZxxxxxx06xxxx" and later. The Lot number and service modification code is mentioned the serial number label on the rear panel. (ex.MZxxxxxx06xxxx).

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.