



## Service Bulletin

No. : MZ02-003

Date: December 4, 2006

---

**Model:** SA8260

**Subject:** Problems with COPY CONTROL CD playability.

**Symptom:** When a COPY CONTROL CD is played, the sound is interrupted momentarily after about 10 seconds.

**Solution:** Replace the microprocessor (Q125) on the PV16 SERVO PWB. The version has changed from (V1.26) to (V1.28).

Note: Confirm the version number of the microprocessor before replacement. The version number is confirmed from the service mode.

1. To enter service mode - While pressing <OPEN/CLOSE> and <Track skip (forward)> button and plug in the AC cord.
2. < Track skip (forward)> button is pressed twice.
3. Q125, u-COM "Drv Ver XX.XX" version will be displayed.

### Parts:

Ref#	Description	Part Number
Q125	microprocessor	HU01AKY100

### Serial Number Range:

This improvement has been done in production after the Lot number "MZxxxxxx05xxxx" and later. The Lot number and service modification code is mentioned the serial number label on the rear panel. (ex. MZxxxxxx05xxxx).

---

#### CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.