

**marantz®**

## **Service Bulletin**

**No. :** MZ02-012

**Date:** December 4, 2006


---

**Model:** SA8260

**Subject:** Problem with playability of CD single

**Symptom:** Dropout is heard in the outer circumference of CD single (8cm, 3inch). This problem is noticed when the record time of the single CD is more than 20 minutes.

**Solution:** If the LOT number is from 01 to 05 and the number of [PV16] PCB is "WI01AK100-0", (The LOT number is "##" of serial number "MZxxxxxx##xxxx".) Please apply the following solution. -Replace the chip resistor [R218] <27k ohm> with <30k ohm>.

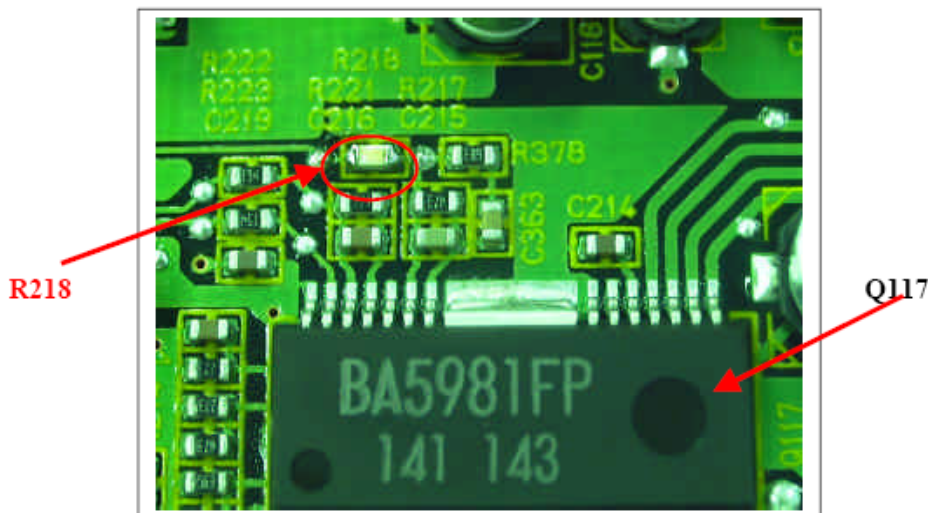


---

### **CONFIDENTIALITY NOTICE:**

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility is will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

If the LOT number is from 06 to 18 (the number of [PV16] PCB is "WI01AK100-2"), Please apply the following solution on the [PV16] PCB.

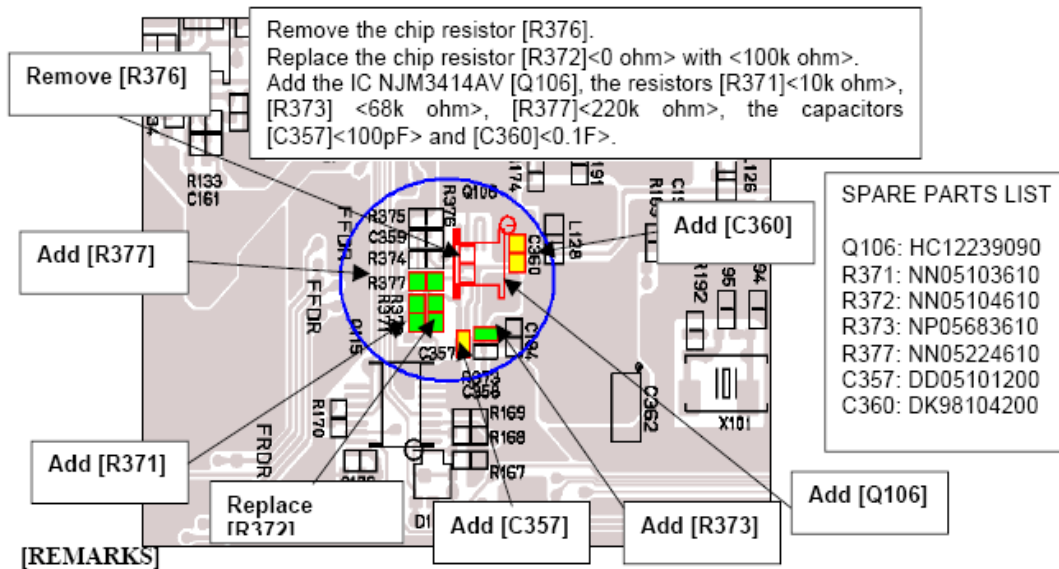

**Parts:**  
for lot # 01 to 05 add the following:

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
R218	CHIP 27K ohm +-5% 1/16W	NN05273610	CHIP 30K ohm +-5% 1/16W	NN05303610
R372	0 ohm	NA	Chip 100K ohm+-5% 1/16W	NN05104610

**For lot # 06 to 18 add the following:**

Ref#	Description	Part Number
Q106	NJM3414AV	HC12239090
R371	10K ohm +-5% 1/16W	NN05103610
R373	68K ohm +-5% 1/16W	NP05683610
R377	220K ohm +-5% 1/16W	NN05224610
C357	100pF	DD05101200
C360	0.1F	DK98104200

#### CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility is will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

## **Serial Number Range:**

This improvement has been done in production after Lot number "MZxxxxxx19xxxx" and later. The Lot number and service modification code is mentioned in the serial number label on the rear panel. (ex.MZxxxxxx19xxxx).

---

### **CONFIDENTIALITY NOTICE:**

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility is will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.