



Service Bulletin

No. : MZ03-007

Date: December 5, 2006

Model: SR5300/SR6300

Subject: Abnormal noise from speaker.

Symptom: Abnormal noise appears from speaker after 10 minutes or so when using a digital input.

Solution: Replace DSP IC CS493263 (IC709) with the improved type.

Parts:

Ref#	Description	Part Number
IC709	DSP IC CS493263	*HC107260R

Serial Number Range:

The countermeasure only needs to be applied to this type of claim (abnormal noise).

The new IC has been applied in production from the following serial number and after.

SR5300/U1B: MZ000242002611 and later

SR6300/U1B: MZ000241000862 and later

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility is will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.