

D&M
D&M Holdings Inc.
100 Corporate Drive Mahwah, NJ 07430

marantz®

Service Bulletin

No. : MZ10-053-1

Date: October 12, 2010

Model: SR7005

Subject: Modification of the Firmware via DPMS (D&M Product Management Server).

Countermeasure is applicable only upon claim from the customer.

Symptom: 1) To improve the problem of the "Wizz App" function for iPhone/iPod.
2) When A/V Receivers in combination with Control 4 Installations, after power failure, A/V Receiver does not reconnect.

Solution: We corrected the firmware so that no malfunction occurs.

Updating the firmware (Refer to the Instruction Manual.)

Time necessary for update: approximately 10 min.

Confirming the firmware's number after upgrading:

After completion of the updating operation, the new version number can be confirmed by starting up the A/V Receiver according to the following procedure. With the following operation, the A/V Receiver can be set to the Flash-ROM Version-Number Confirmation Mode. Turn the power of the A/V Receiver on, while holding both "**STATUS**" button and "**RETURN**" button on the front panel simultaneously.



Every time the "STATUS" Button is pressed, version numbers of the MAIN, SUB, etc. are indicated on the front panel section in the following order.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

METHOD OF FIRMWARE UPDATE VIA RS232C:

We will supply the following program files for updating the subject models.
Please refer to the following Instruction Manual for updating.

Time necessary for update: approximately 40 min.

DFW software:

DFW_0005_SR7005_(Rev.1.0.13).exe:
Firmware Update Program

DFW 0005 SR7005 Rev.1.0.13 Manual EN.pdf:

Instruction Manual for Firmware Update Program for SR7005

Firmware:

SR7005_U_100100050200-0004.zip:
Firmware for SR7005

SR7005

	Name	Version
1	Main	93.55
2	Main FBL	00.10
3	Sub	27.17
4	Sub FBL	05.01
5	DSP	60.06
6	Audio PLD	05.02
7	OSD CFG	200912070011
8	OSD PRG	201006111006
9	OSD DAT	201006111008
10	DM860 SBL	201002081213
11	DM860 IMG	201009100618

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Serial Number Range:

We will apply the above modification to the production models in the following serial numbers.

20001040***** ~ (From October 2010 production)

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.