

D&M
D&M Holdings Inc.
100 Corporate Drive Mahwah, NJ 07430

marantz®

Service Bulletin

No. : MZ02-017


Date: December 4, 2006

Model: SR7200

Subject: Pop noise when powering the set ON.

Symptom: A pop noise is heard from the Center speaker, Surround L/R and Surround Center speaker when powering the set ON.

Solution: Change the Electrolytic capacitor C146 (10uF/50V) to a 47uF/16V. C146 is located on the MAIN circuit board.

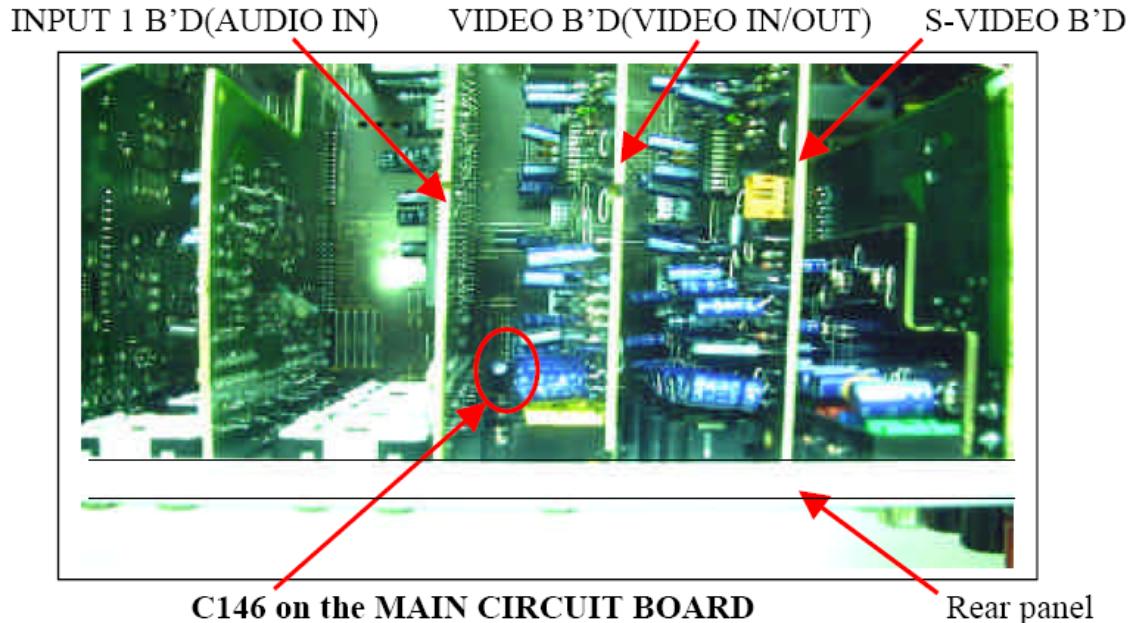

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Parts:

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
C146	10uF/50V	NA	47uF/16V	EA47601610

Serial Number Range:

- 1) The countermeasure applies to this type of claim only.
- 2) This improvement has been done in production after serial number MZ030227004911 and later. (SR7200/U1B)

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.