



Service Bulletin

No. : MZ09-008

Date: February 18, 2009

Model: SR7002, SR8002

Subject: Software Update Information

Symptom: 1. The HDCD indicator will not light up when the unit is switched from the function of playing HD-Audio (eg. DTS-Master Audio) via HDMI to that of playing HDCD input via SPDIF.
2. On SR7002N and SR8002N, the “#” character used for RDS will turn into “II”.
3. When the HDMI connector is slowly inserted with the projector made by Epson etc., HDMI might not be linked.

Solution: The MAIN CPU and HDMI CPU software must be updated. First, please check the version of the current firmware in reference to SERVICE MODE of the Service Manual. After performing the update, check the indicated firmware version. For information on how to rewrite the firmware, open the Service Manual and refer to “7. UPDATE FIRMWARE”.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

Firmware version History

Service Code	REF.NBR.	MAIN CPU	HDMI CPU	DSP CODE
MZ08	MZ09-008	V090121 1	h39	B1 10805081 B2 20803131
MZ07	MZ08-038	V080603 1	h38	B1 10805081 B2 20803131
MZ06	MZ08-023	V080313 1	h35	B1 10708201 B2 20708231
MZ05	-	V080307 1	h34	B1 10708201 B2 20708231

Latest

Please check the version of the firmware and, if any of the above is found yet to be updated, make sure to perform the latest update.

Update software and Part no.

1) Firmware – Main: sr8002Main090121_1.mot

Parts No: 00M36CW499A08 (For how to rewrite, see the Service Manual on Page 21.)

2) Firmware – HDMI: HDMI_REPV3x090122h39.mot

Parts No: 00M36CW499B06 (For how to rewrite, see the Service Manual on Page 31.)

Serial Number Range:

This problem applies to the following serial number.

1) SR7002, SR8002 applies to MZ07xxxxxxxx (Service code 07 and earlier).

This improvement has been done in production from serial number MZ08xxxxxxxx (Service code 08 and after).

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.