

# aiwa

AIWA CO.,LTD

UTSUNOMIYA FACTORY

2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN

## SERVICE TECHNICAL INFORMATION


### ONE POINT REPAIR

UTSUNOMIYA, SEPTEMBER 2, 1996

REF. NO. : SI-96-027

CUSTOMER RELATIONS & SERVICE DIV.

- MODEL : CA-DW600/DW610 NSX-E6/EK6  
SUBJECT : Peeling shield paper  
SYMPTOM : Shield paper attached to the front board peels off. The paper then rubs against the CD TRAY during CD OPEN/CLOSE, or protrudes from between the CD TRAY.  
REMEDY : As shown in the figure below, glue the shield paper to a position where it will not come into contact with the CD TRAY.

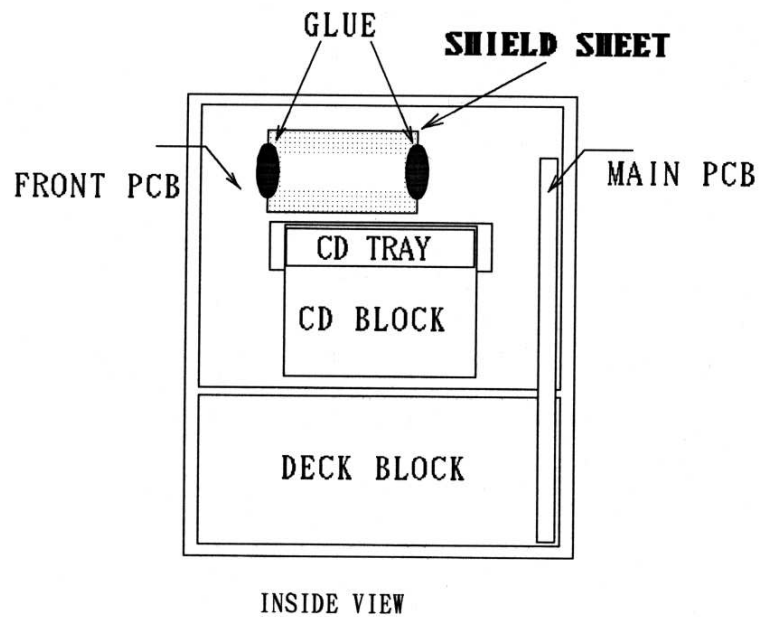

- \* Add a black dot (●) to the end of the serial number of each repaired set.
- \* This remedy has been performed for models as of the July '96 production lot.