



Service Bulletin

No. : MZ09-022

Date: April 1, 2009

Model: SR4002, SR5002, SR4003, SR5003, SR6003

Subject: Improvement of GND screws contact.


This is a repair tip for a Unit in Protect mode (Fast blinking Standby LED) this is not a call for rework and does not apply to stock units.

Symptom: The unit may intermittently go into protection (Fast blinking Standby LED). No problems are found in the output circuitry and heat is not an issue. The ground point screw on a Main board can loosen during transportation, handling etc., and the contact to ground may become intermittent causing a protect situation.

Solution: Add a toothed washer between the ground point screw and PCB land located on a Main board (see diagram below) and then tighten the screw.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

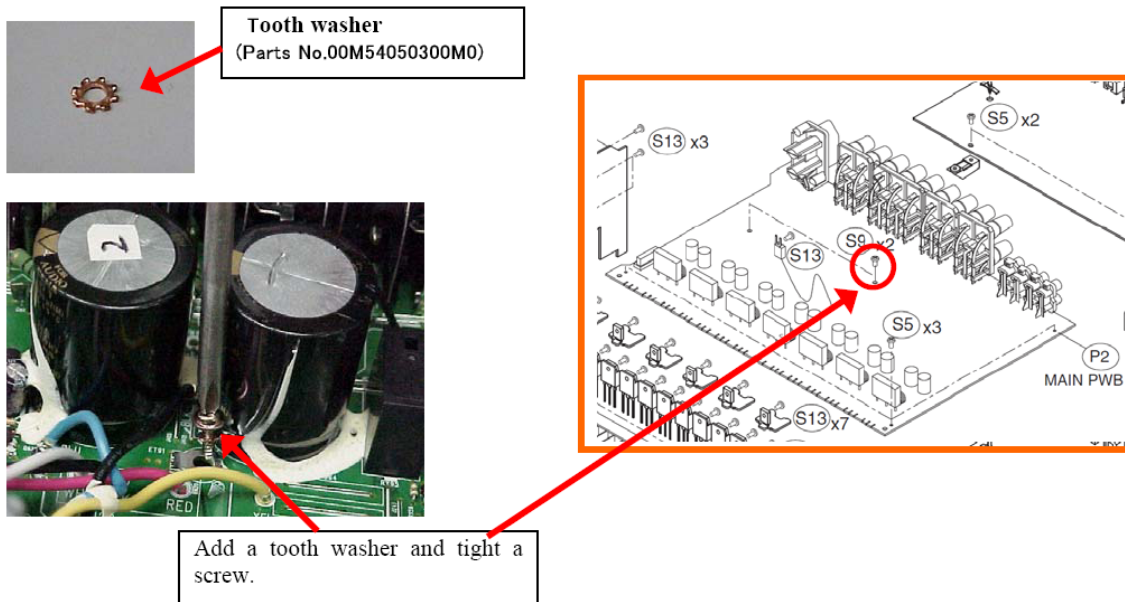

Parts:

Ref#	Description	Part Number
NA	Tooth Washer	00M54050300M0

Serial Number Range:

SR4003: Up to "MZxx0842004880" From "MZxx0842004881": Modified on mass production lines

SR5003: Up to "MZ040911007560" From "MZ040911007561": Modified on mass production lines

SR6003: Up to "MZxx0842003800" From "MZxx0842003801": Modified on mass production lines

Note: The SR4002 and SR5002 production has been finished so apply as required.

CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.