



CONNECTIONS

Make connections to mating "Varicon" connector per illustration:

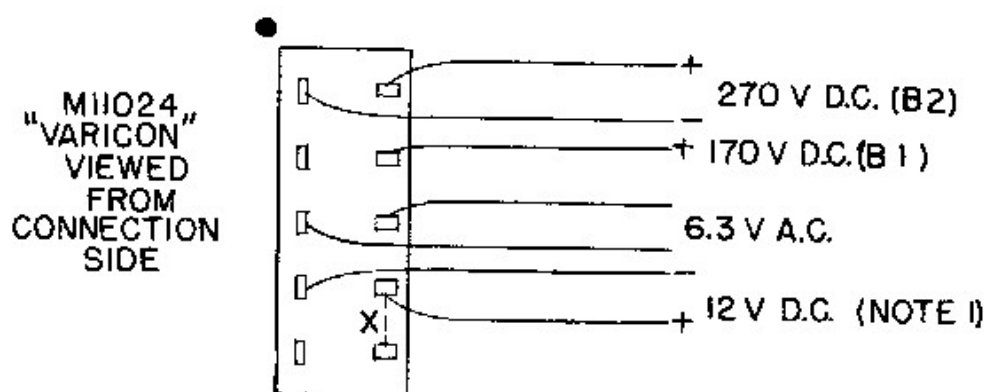

Note 1: With load of one to four 1561A Preamplifiers and/or 1562A Tone Control Amplifiers, connect strap X. With five to eight units do not strap.

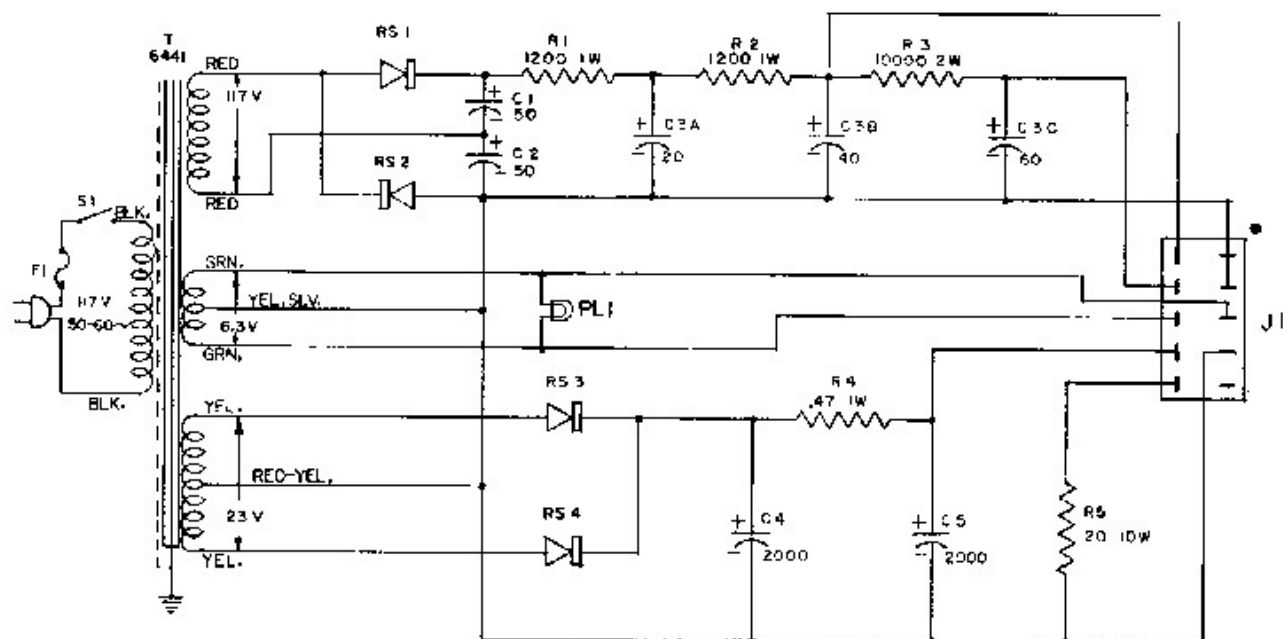

PARTS LIST

C1, 2	50 mfd, 250 v Tubular Mallory TC 59	T1	Transformer, power, Peerless 6441
C3	20-60-40 mfd, 350, 300, 300 v, Mallory type FP, SPO 20-11235	S1	Switch, rotary, H & H 1561
C4, 5	2,000 mfd, 15 v, Mallory, WPO 41	PL1	Pilot lamp, Mazda 51
R1, 2	1,200 ohms, $\pm 10\%$, 1 w	F1	Fuse, 1 a, 3 AG
R3	10,000 ohms, $\pm 10\%$, 2 w	J1	Connector, male, ELCO "Varicon" M11024 and Connector, female, ELCO "Varicon" F11020-2
R4	.47 ohms, 1 w, IRC BW-1	RS1, 2	Rectifier, silicon, 400 v PIV, Mallory T400
R5	20 ohms, 10 w, Axial, W. L.	RS3, 4	Rectifier, silicon, 100 v PIV, Motorola 1N1569