

aiwa

AIWA CO.,LTD
UTSUNOMIYA FACTORY
2620, TOKUJIROU-MACHI, UTSUNOMIYA-SHI, TOCHIGI 321-21, JAPAN



SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, February 28, 1995
REF. NO. : SI-94-051
CUSTOMER RELATIONS & SERVICE DIV.

MODEL : AM - F1
SUBJECT : ALC characteristic change
SYMPTOM : The customer indicates such things as level fluctuation and sound distortion during analog REC (LINE, MIC). In such cases, perform the following remedy in order to change the ALC (auto level control) characteristic.
However, explain to the customer that this ALC is set on the premise of being used in a long running mode (monophonic recording), and to some degree similar symptoms will occur even after performing the following remedy.

REMEDY : Remove the parts shown below and change the constant.

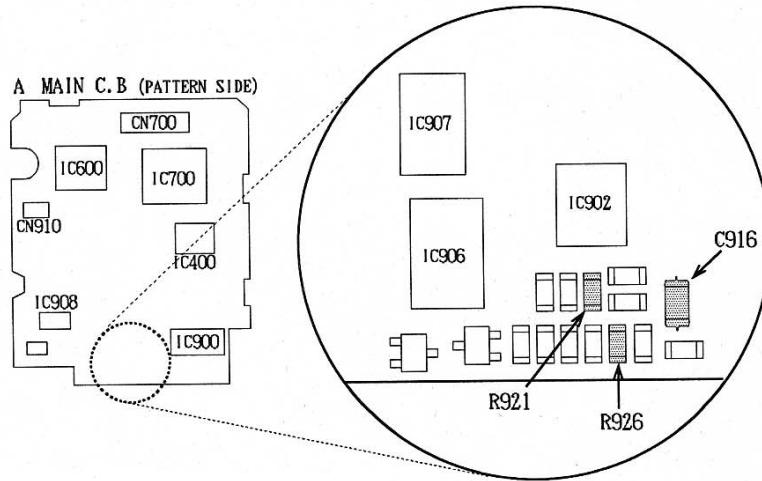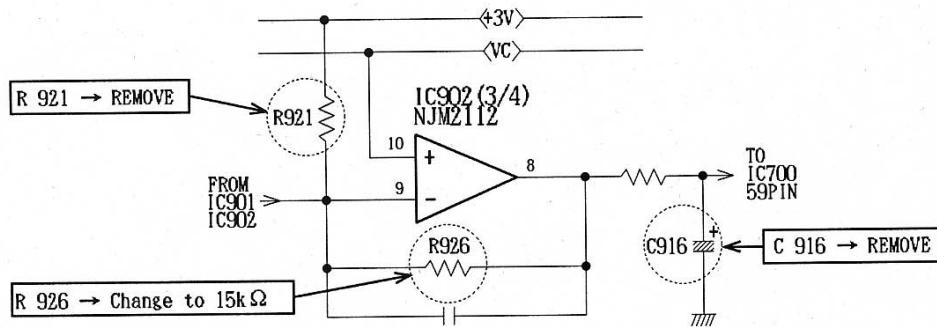

Ref. No.	Part Name	Part No.
R926	C-RES, U 15K-1 / 16W	88-108-153-080