

SERVICE TECHNICAL INFORMATION

ONE POINT REPAIR

UTSUNOMIYA, DECEMBER 30, 1997

REF. NO.: SI-97-059

CUSTOMER RELATIONS & SERVICE DIV.

MODEL S : XR-AKH100, NSX-KH9, AKH8


SUBJECT : The laser pickup is always on.

DESCRIPTION : During the CD function, it is found that the laser pickup is always on regardless of CD STOP.

When repairing the aforementioned models, take the following countermeasures.

- REMEDIES : 1) Remove R223 shown in the circuit diagrams (CD MAIN C.B) indicated below.
- 2) Short the patterns on both sides of R223.

E CD MAIN C.B

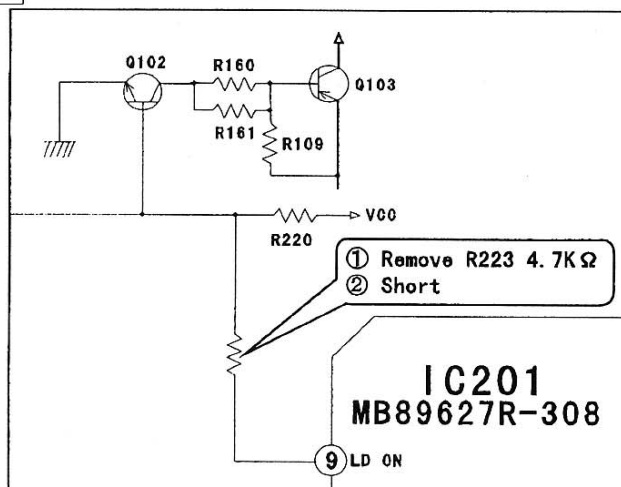

E CD MAIN C.B

