



## Service Bulletin

No. : MZ03-005

Date: December 5, 2006

---

**Model:** SA8260

**Subject:** Improvement to playability of CD and Super Audio CD

**Symptom:** Will not read TOC, will not start playback, the sound skips with some CD's and Super Audio CD's.

**Solution:** If the LOT number is from 01 to 05, (The LOT number is "##" of serial number "MZxxxxxx##xxxx".) Please apply the solution found in service bulletins "MZ02-001" and "MZ02-002".

If the LOT number is from 01 to 18 (only). Replace the servo MPU (Micro Processor Unit) [Q125] with the latest one <Drv Ver. 01.34> (Part No. HU01AKY12F) on the [PV16] PCB.

\*\*\*How to confirm the version of the servo MPU\*\*\*


1. Press and hold the [OPEN/CLOSE] and [SKIP/FF] buttons, then connect the power plug.
2. Press the [SKIP/FF] button twice, then the version will show "Drv Ver XX.XX" on the display.2) [01 to 18 Lot only] Add the resistor <1k ohm> (Part No. GD05102160) on the [PV16] PCB as follows;

---

### CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

If the LOT number is from 06 to 18, Please apply the following solution.

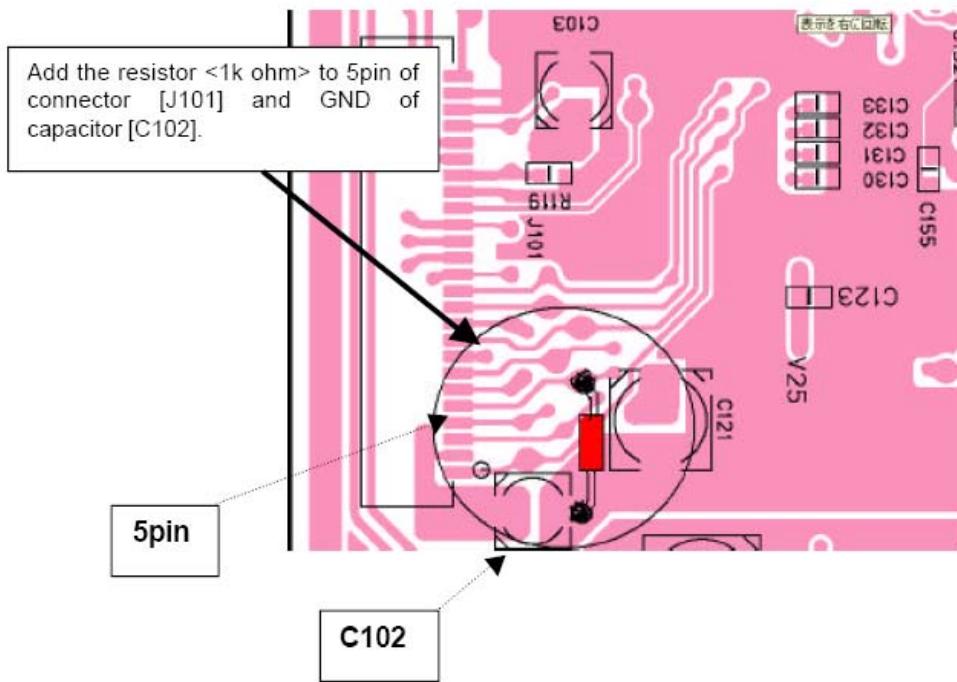

If the Lot # is 19 to 20 only (The LOT number is "##" of serial number "MZxxxxxx##xxxx".) do the following: Replace the servo MPU (Micro Processor Unit) [Q125] with the latest one <Drv Ver. 01.34> (Part No. HU01AKY12F) on the [PV16] PCB.

\*\*\*How to confirm the version of the servo MPU\*\*\*


1. Press and hold the [OPEN/CLOSE] and [SKIP/FF] buttons, then connect the power plug.
2. Press the [SKIP/FF] button twice, then the version will show "Drv Ver XX.XX" on the display.2) [19 to 20 Lot only] Remove the resistor <39k ohm> on the [PV16] PCB as follows;

---

#### CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

If the LOT number is from 19 to 20, (The LOT number is "##" of serial number "MZxxxxxx##xxxx".) Please apply the following solution:

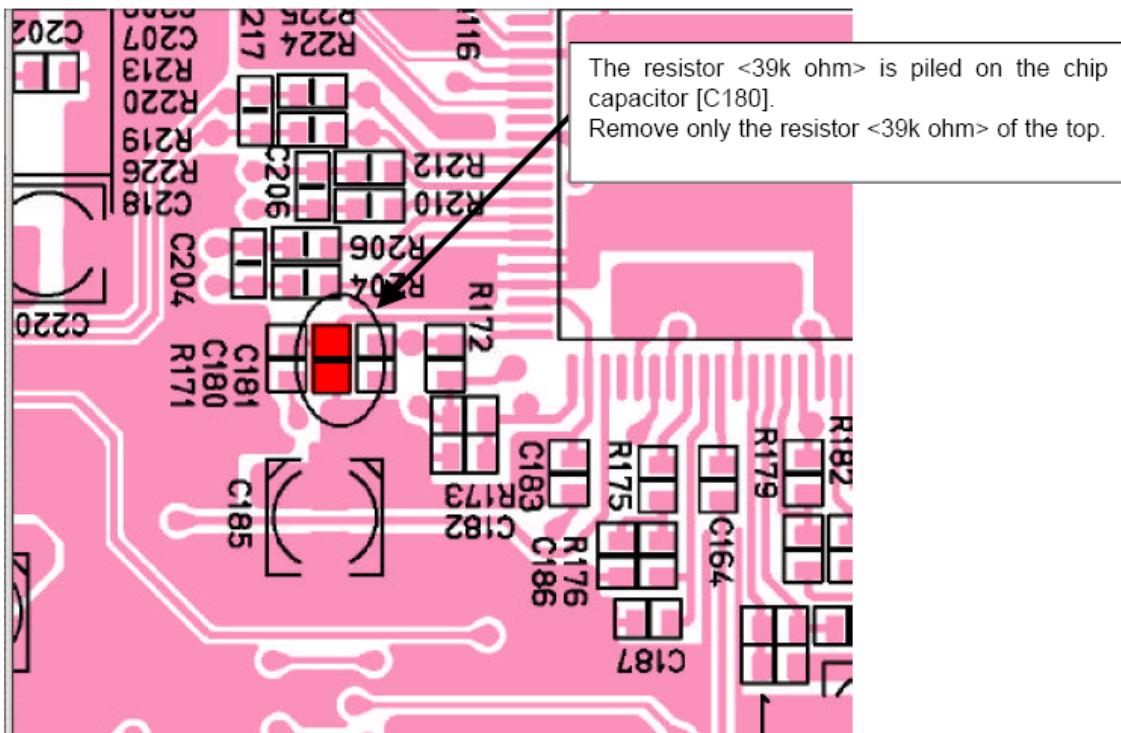

## Serial Number Range:

This improvement has been done in production after LOT number "21" and later  
(The LOT number is "##" of serial number "MZxxxxxx##xxxx".)

---

### CONFIDENTIALITY NOTICE:

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.