

**D&M**  
D&M Holdings Inc.  
100 Corporate Drive Mahwah, NJ 07430

**marantz®**

**Service Bulletin**

**No. : MZ03-035**


**Date: December 5, 2006**

**Model:** SA8260

**Subject:** Extension command Operation of "STANDBY ON "and "STANDBY OFF" is reversed.

**Symptom:** When an extension command is used, this problem occurs. The supplied RC8260SA remote controller does not have the ability to send this command therefore, this problem does not occur when using RC8260SA remote controller.

**Solution:** Replace MICRO PROCESSOR QF01 on the PV16-SERVO PWB. Note: This problem was improved from VER 0.51 on. Before replacing QF01 please check the version of QF01 in the unit. Version number can be confirmed through SERVICE MODE, (Refer to service manual page 2).

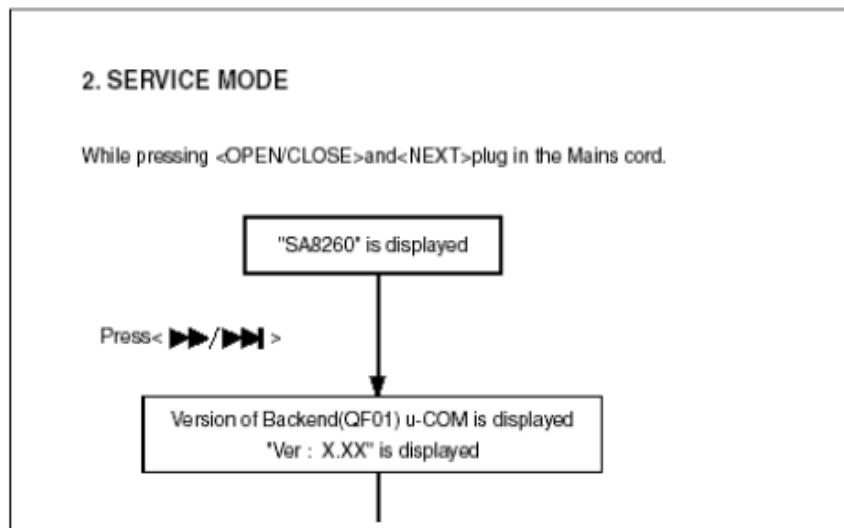

**CONFIDENTIALITY NOTICE:**  
The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.

**Parts:**

Ref #	FORMER		NEW	
	Description	Part Number	Description	Part Number
QF01	CPU	HU01AKF00F	CPU	HU01AKF02F

**Serial Number Range:**

This countermeasure only applies to this type of claim.

---

**CONFIDENTIALITY NOTICE:**

The information contained in this document is intended for the exclusive use by MARANTZ Authorized Service Centers and their employees. This document may contain information that is privileged, confidential and may be protected from disclosure under applicable laws and terms of the MARANTZ Service Agreement. Any distribution, disclosure, dissemination or copying of this document and the information it contains is prohibited. No responsibility is will be accepted by MARANTZ for any damage, injury or loss resulting from the misuse of the information contained in this document.