




- Remote control unit

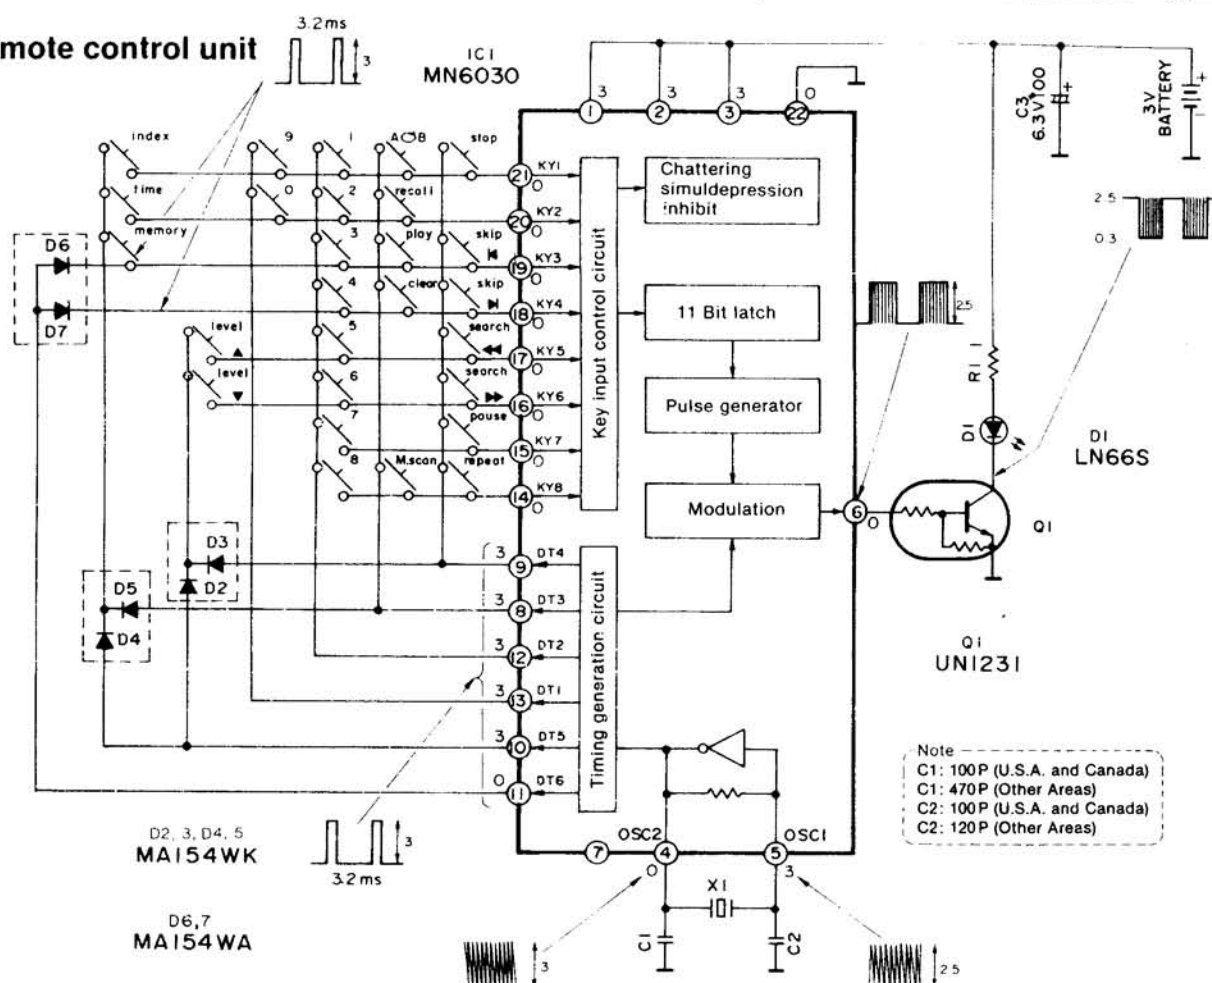

Note


C1: 100 P (U.S.A. and Canada)
C1: 470 P (Other Areas)
C2: 100 P (U.S.A. and Canada)
C2: 120 P (Other Areas)

- Remote control data code

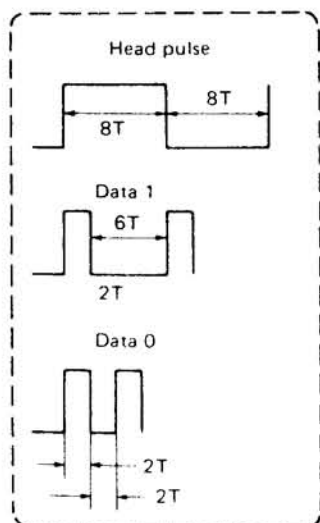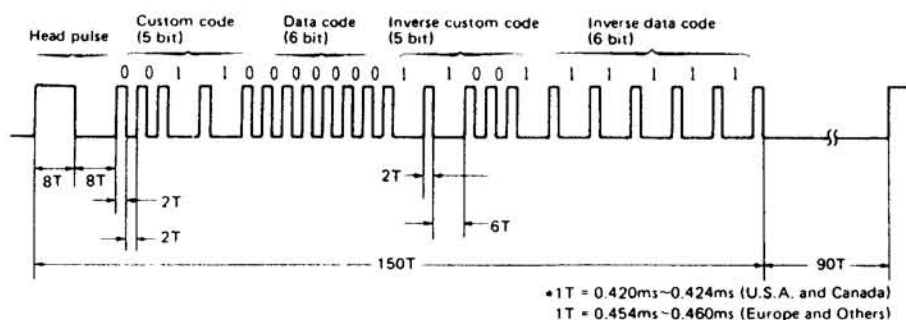

Button	Data Code
1	0 0 0 0 1 0
2	1 0 0 0 1 0
3	0 1 0 0 1 0
4	1 1 0 0 1 0
5	0 0 1 0 1 0
6	1 0 1 0 1 0
7	0 1 1 0 1 0
8	1 1 1 0 1 0
9	0 0 0 1 1 0
0	1 0 0 1 1 0
memory	0 1 0 1 0 1
index	0 0 0 1 0 1
time	1 0 0 1 0 1
stop	0 0 0 0 0 0


Button	Data Code
clear	1 1 0 1 0 0
A-B repeat	0 0 0 1 0 0
repeat	1 1 1 0 0 0
M scan	1 1 1 1 0 0
recall	1 0 0 1 0 0
◀◀ search	0 0 1 0 0 0
search ▶▶	1 0 1 0 0 0
◀ skip	0 1 0 0 0 0
skip ▶	1 1 0 0 0 0
pause	0 1 1 0 0 0
play ▶	0 1 0 1 0 0
▼ level	1 0 1 0 0 1
level ▲	0 0 1 0 0 1

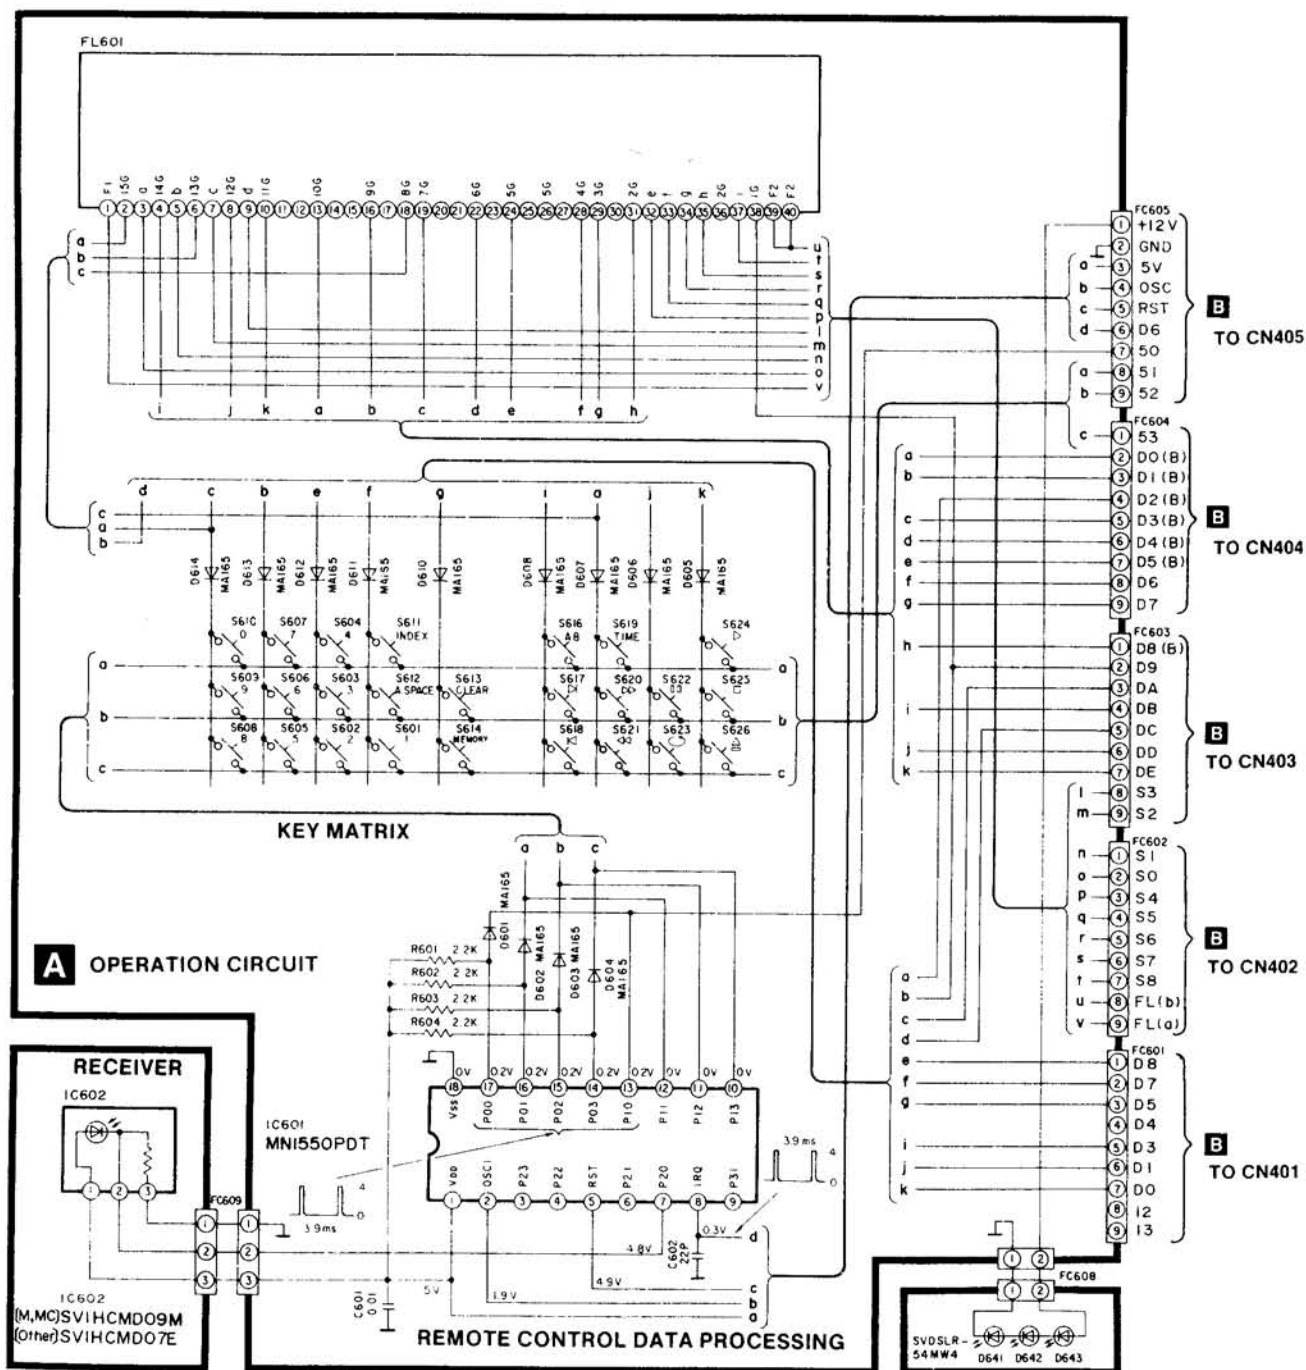


- Power supply circuit
(For Continental Europe and Australia)

- Power supply circuit
(For others)


E

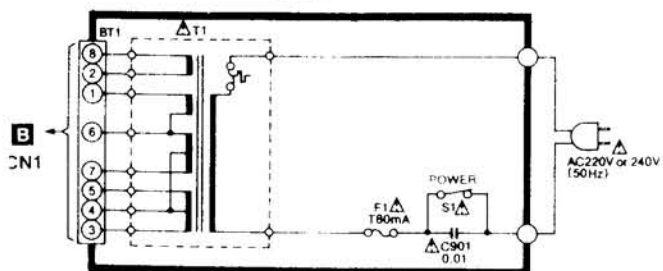

E

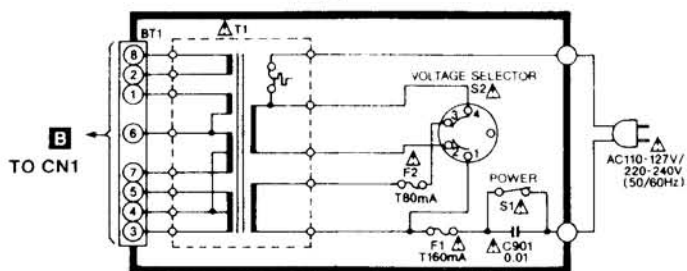




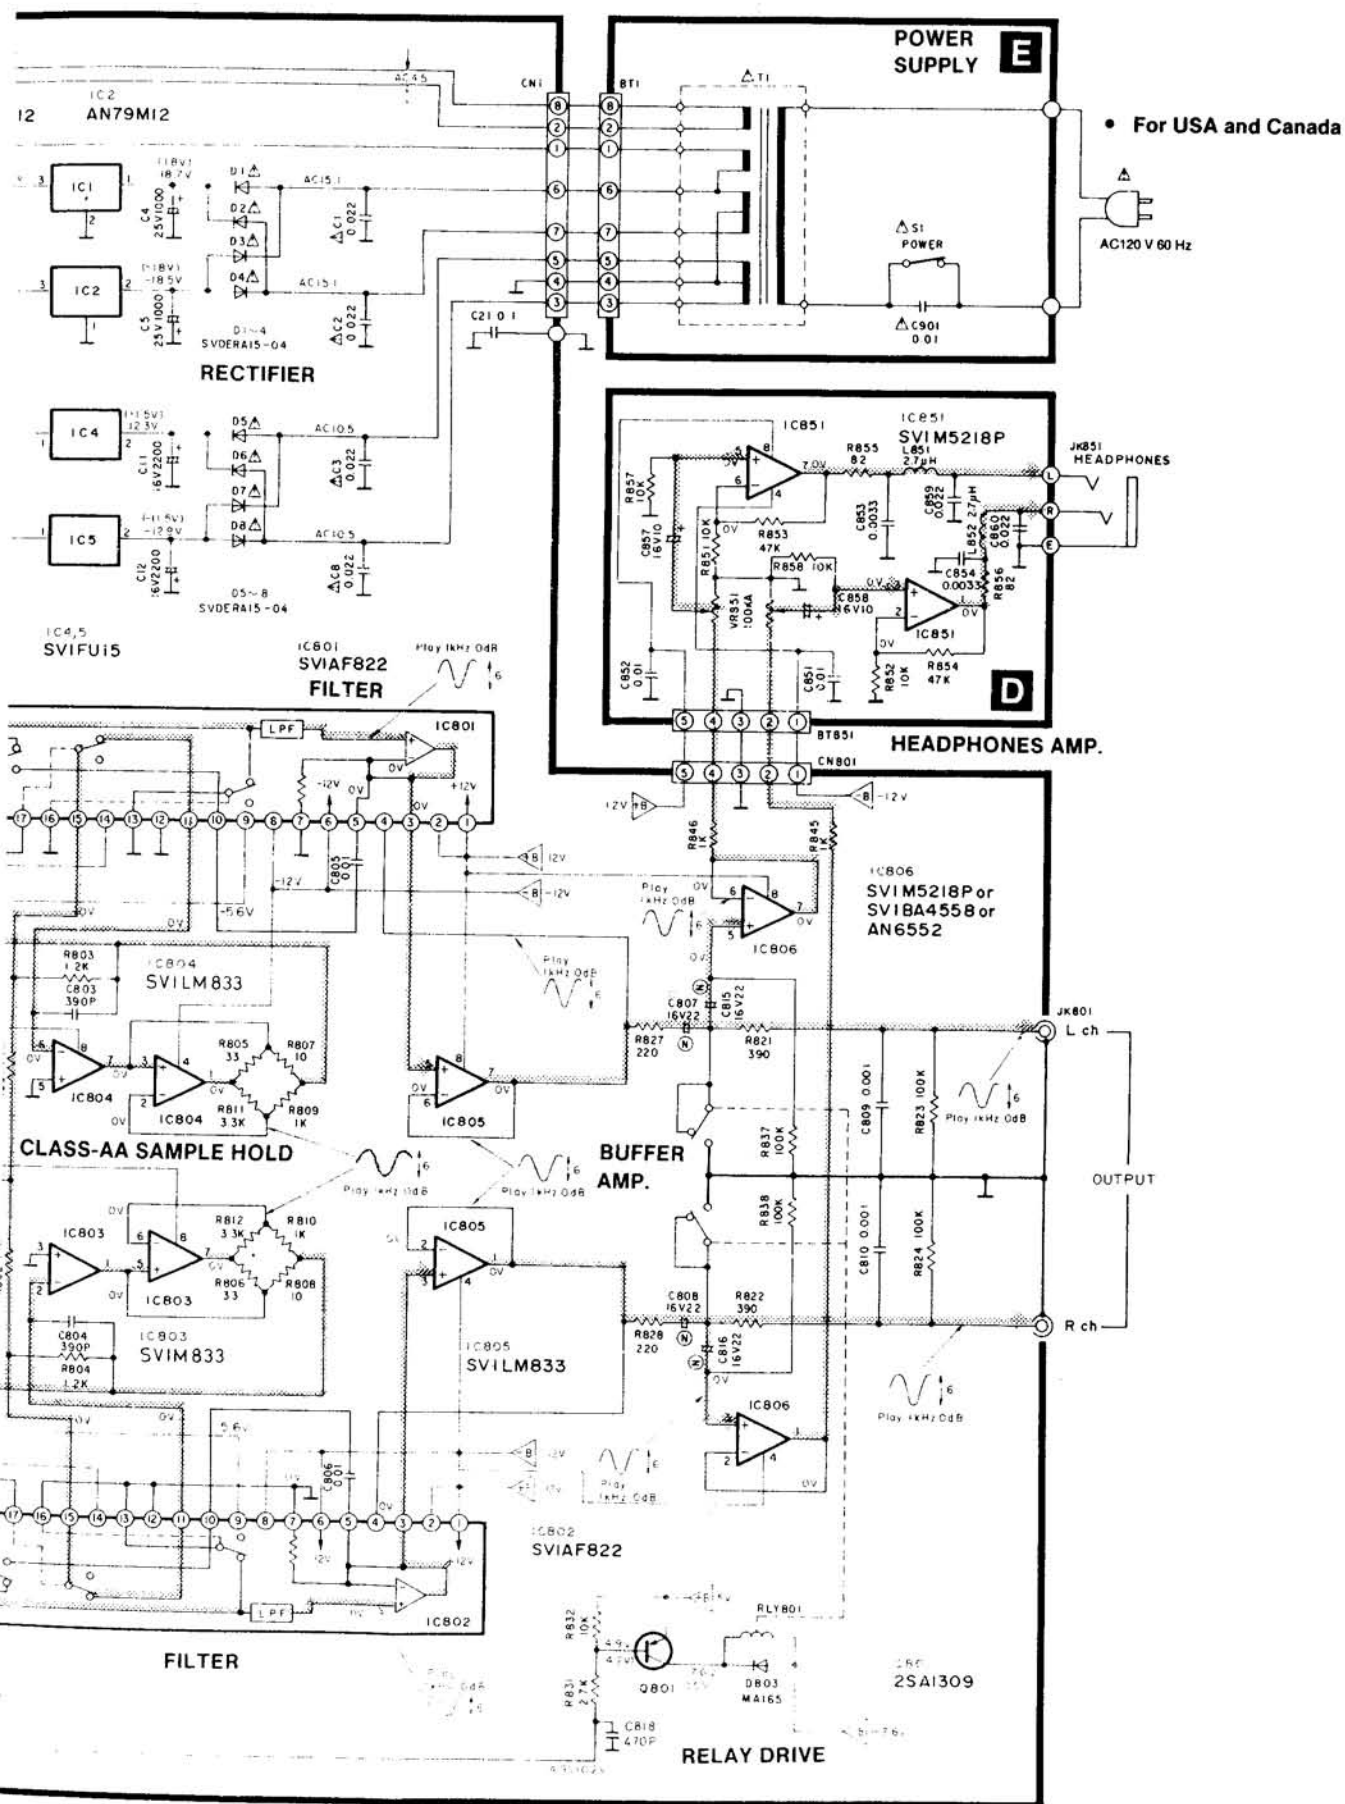


■ BLOCK DIAGRAM



OPTICAL SERVO (FOCUS, TRACKING and LASER POWER CONTR

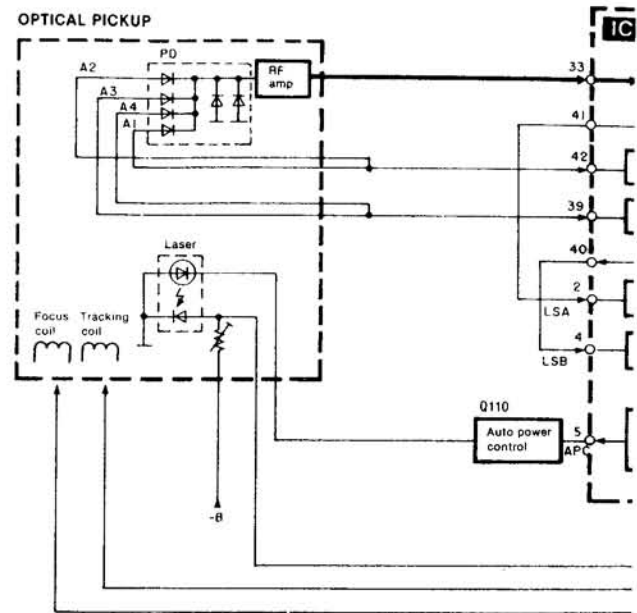



SPINDLE MOTOR DRIVE

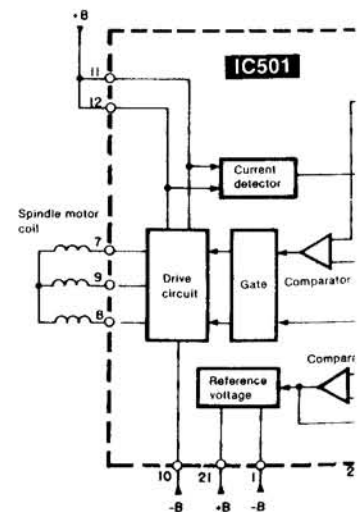


■ BLOCK DIAGRAM

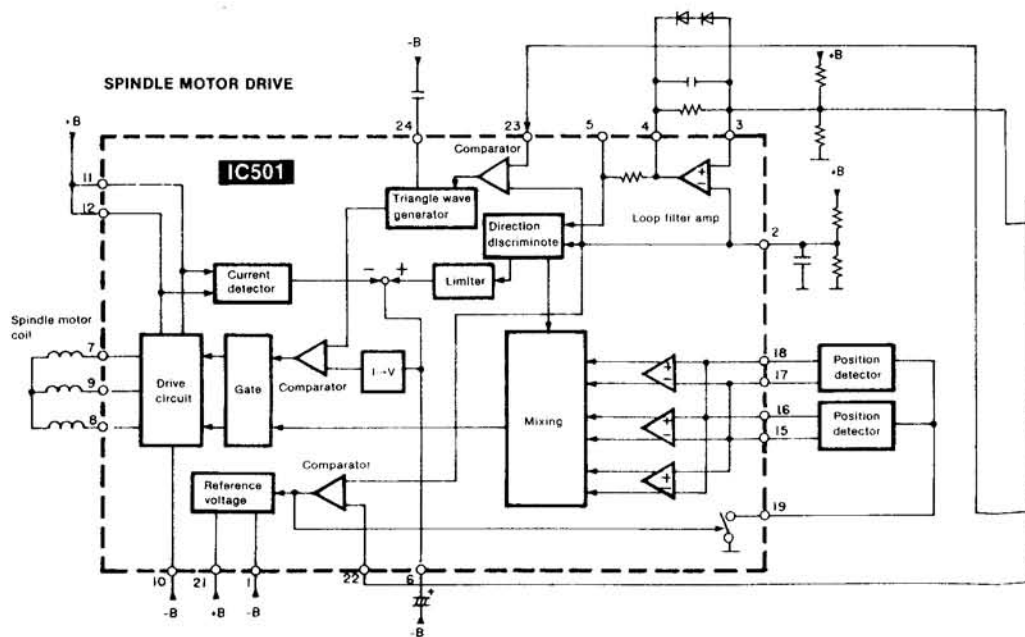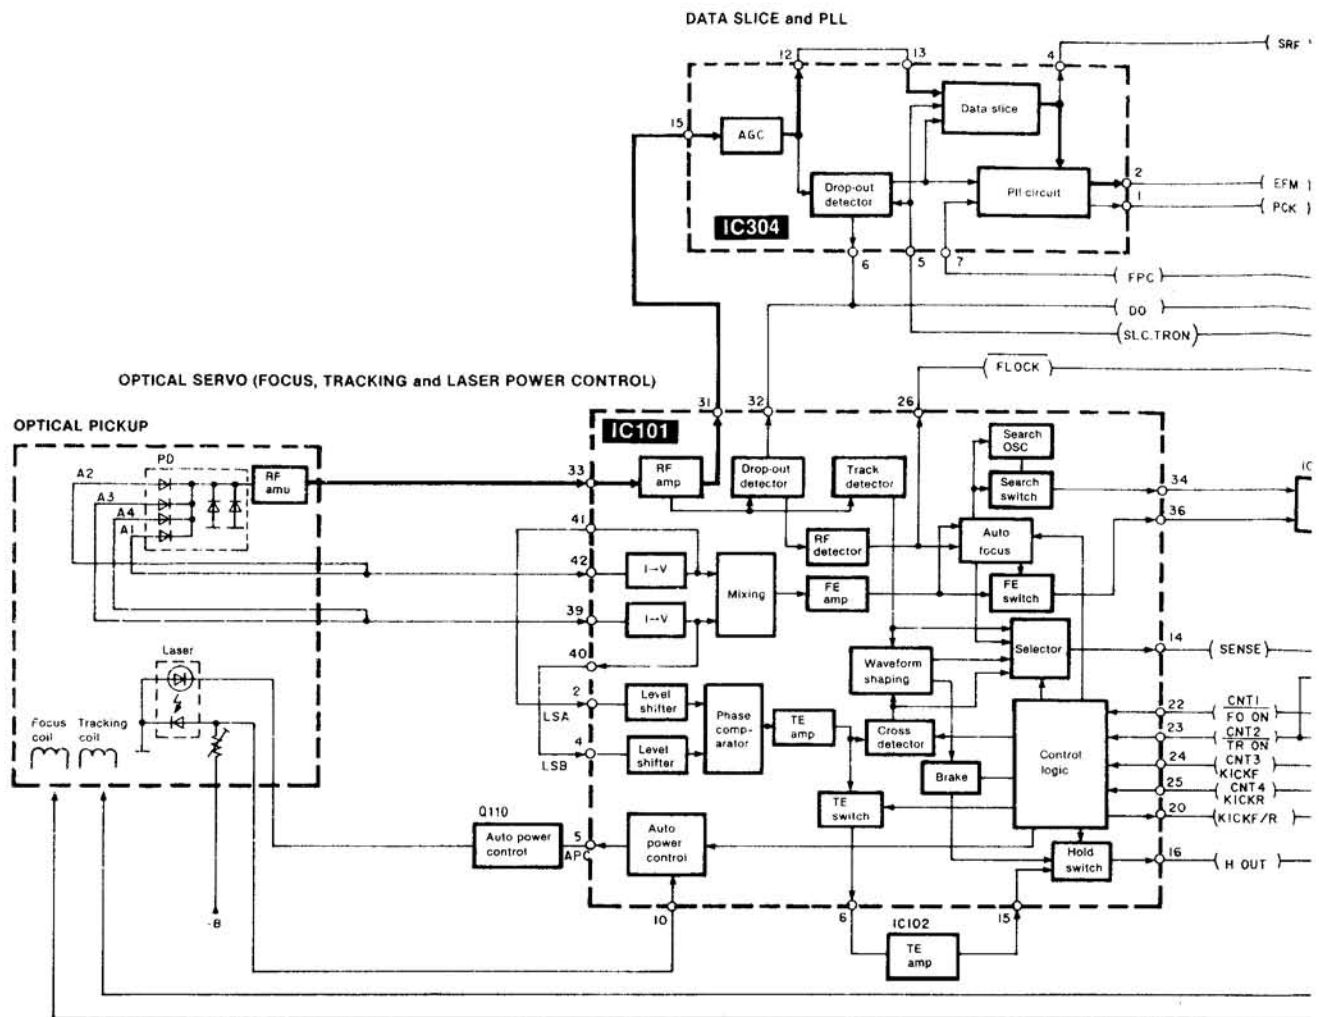

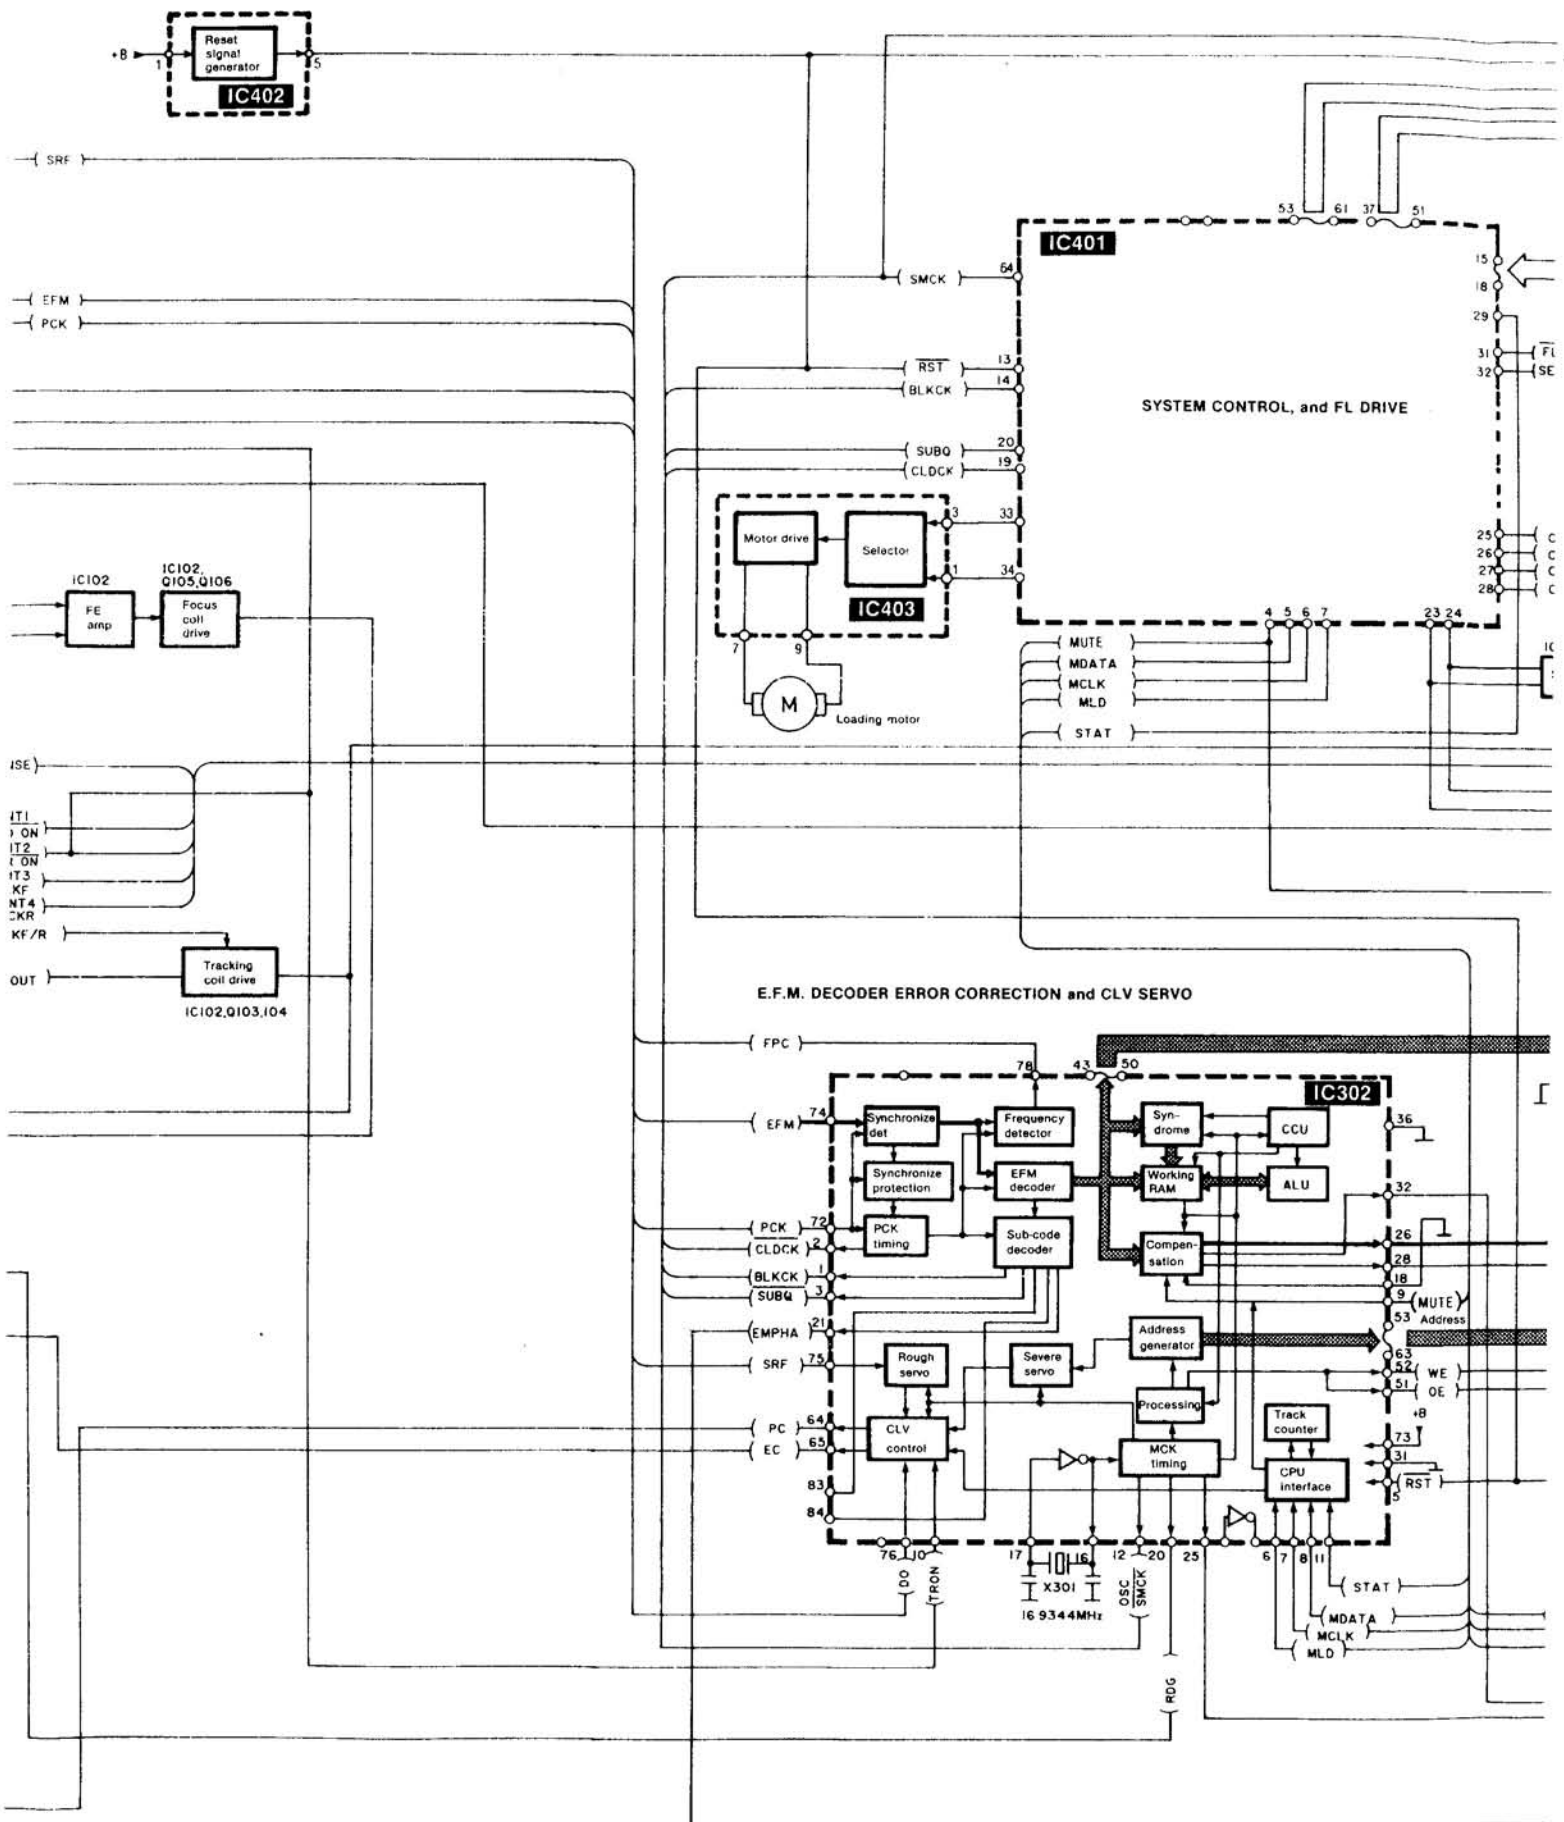

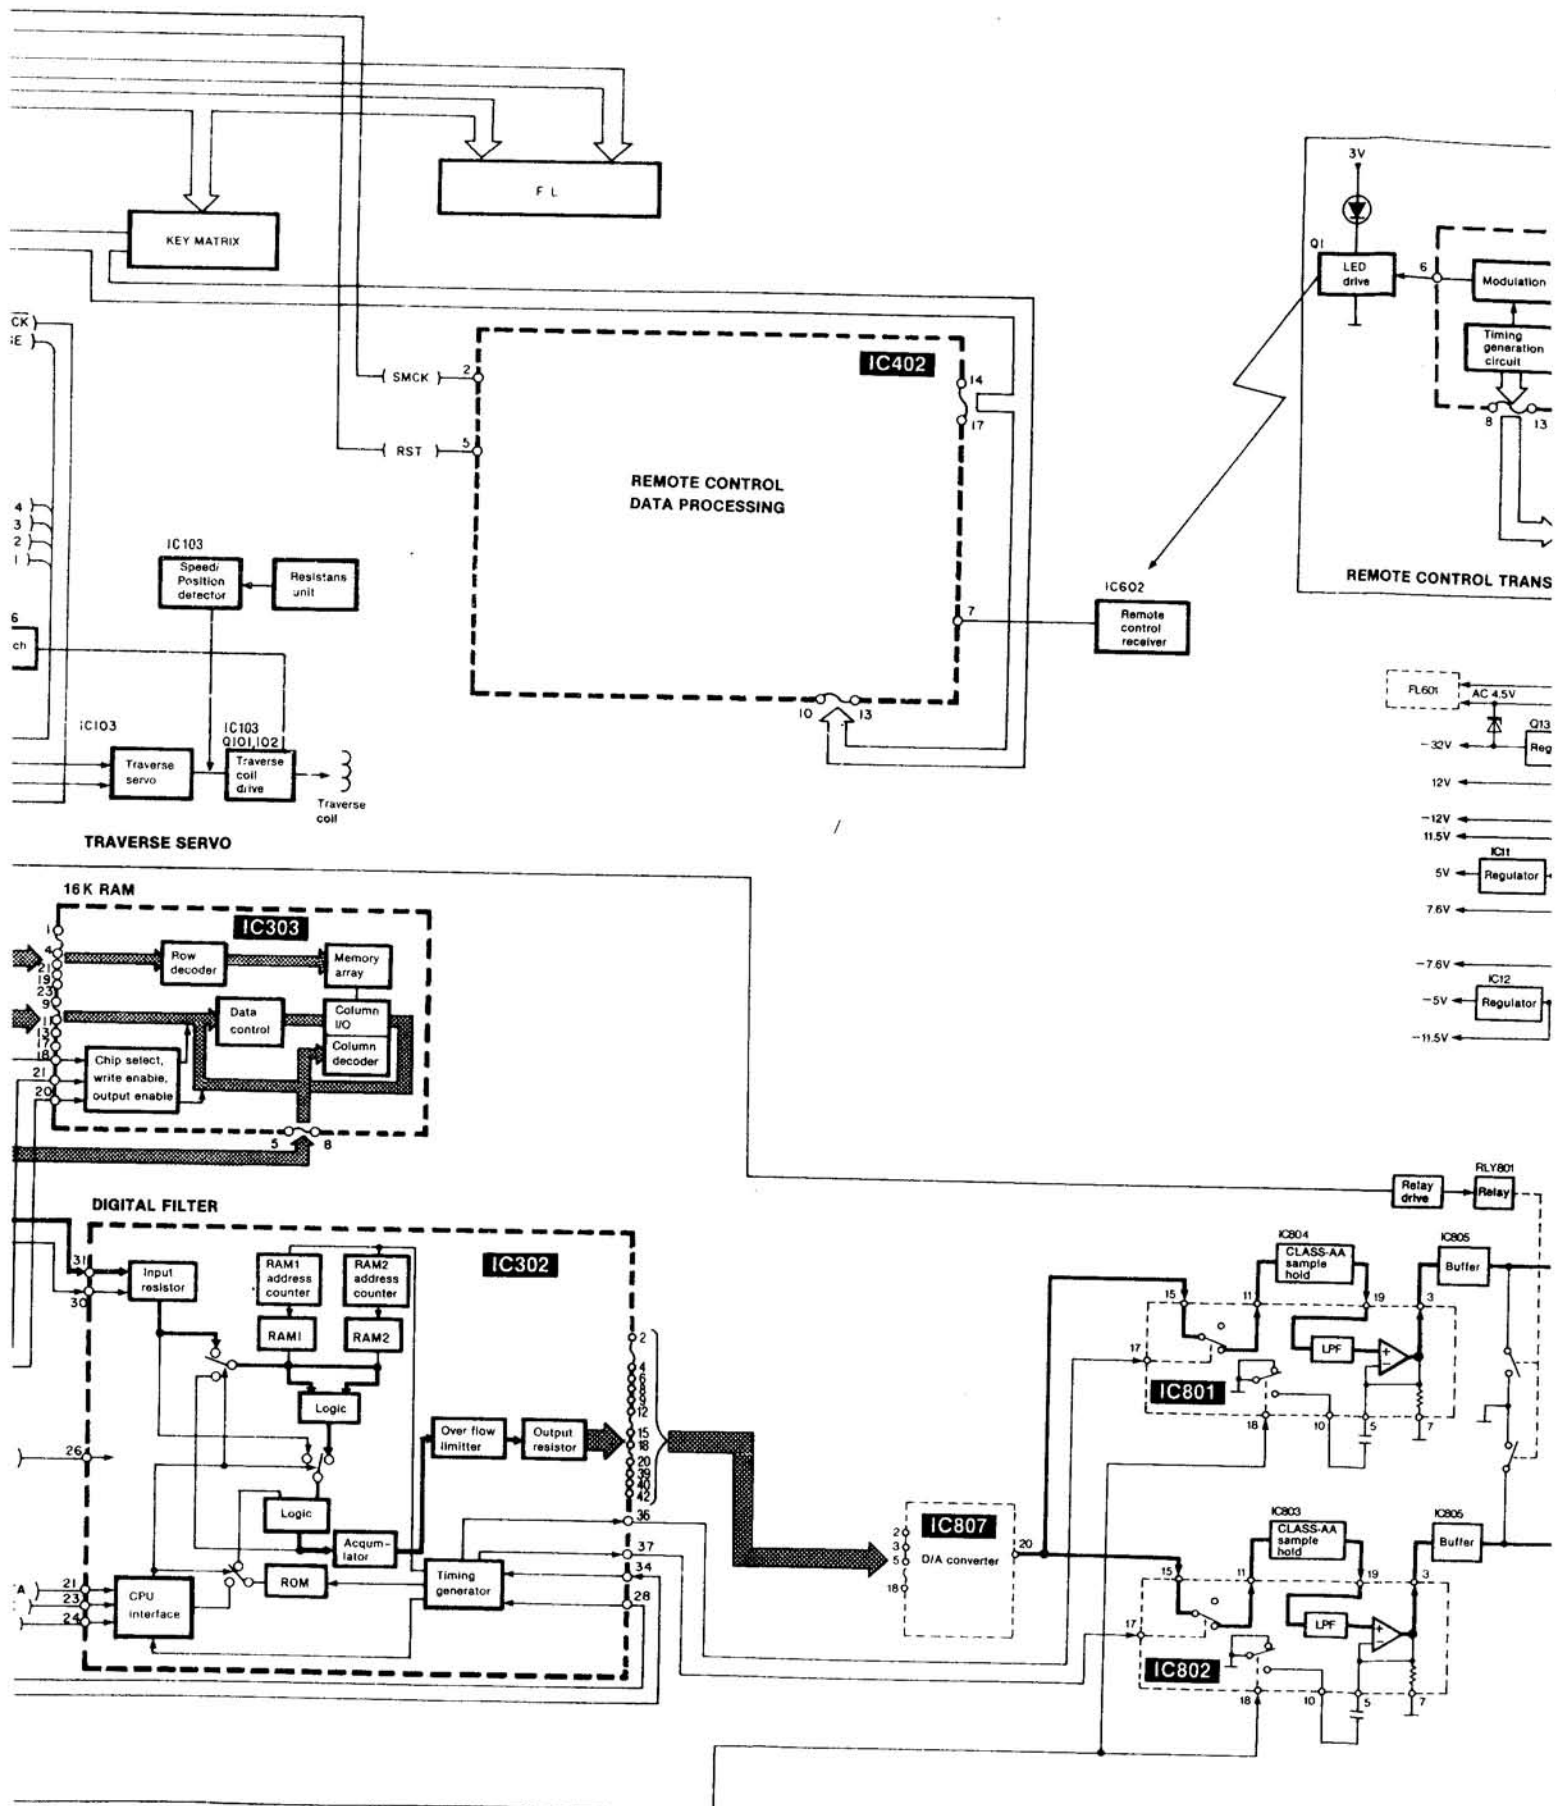

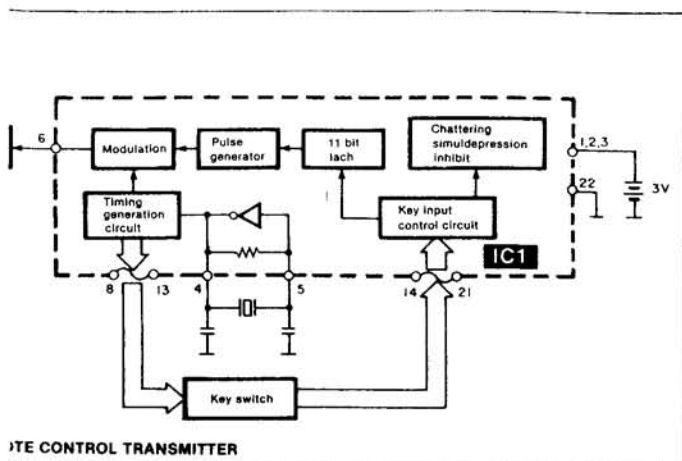

MORSE CODE CONTROL TRANSMITTER

