


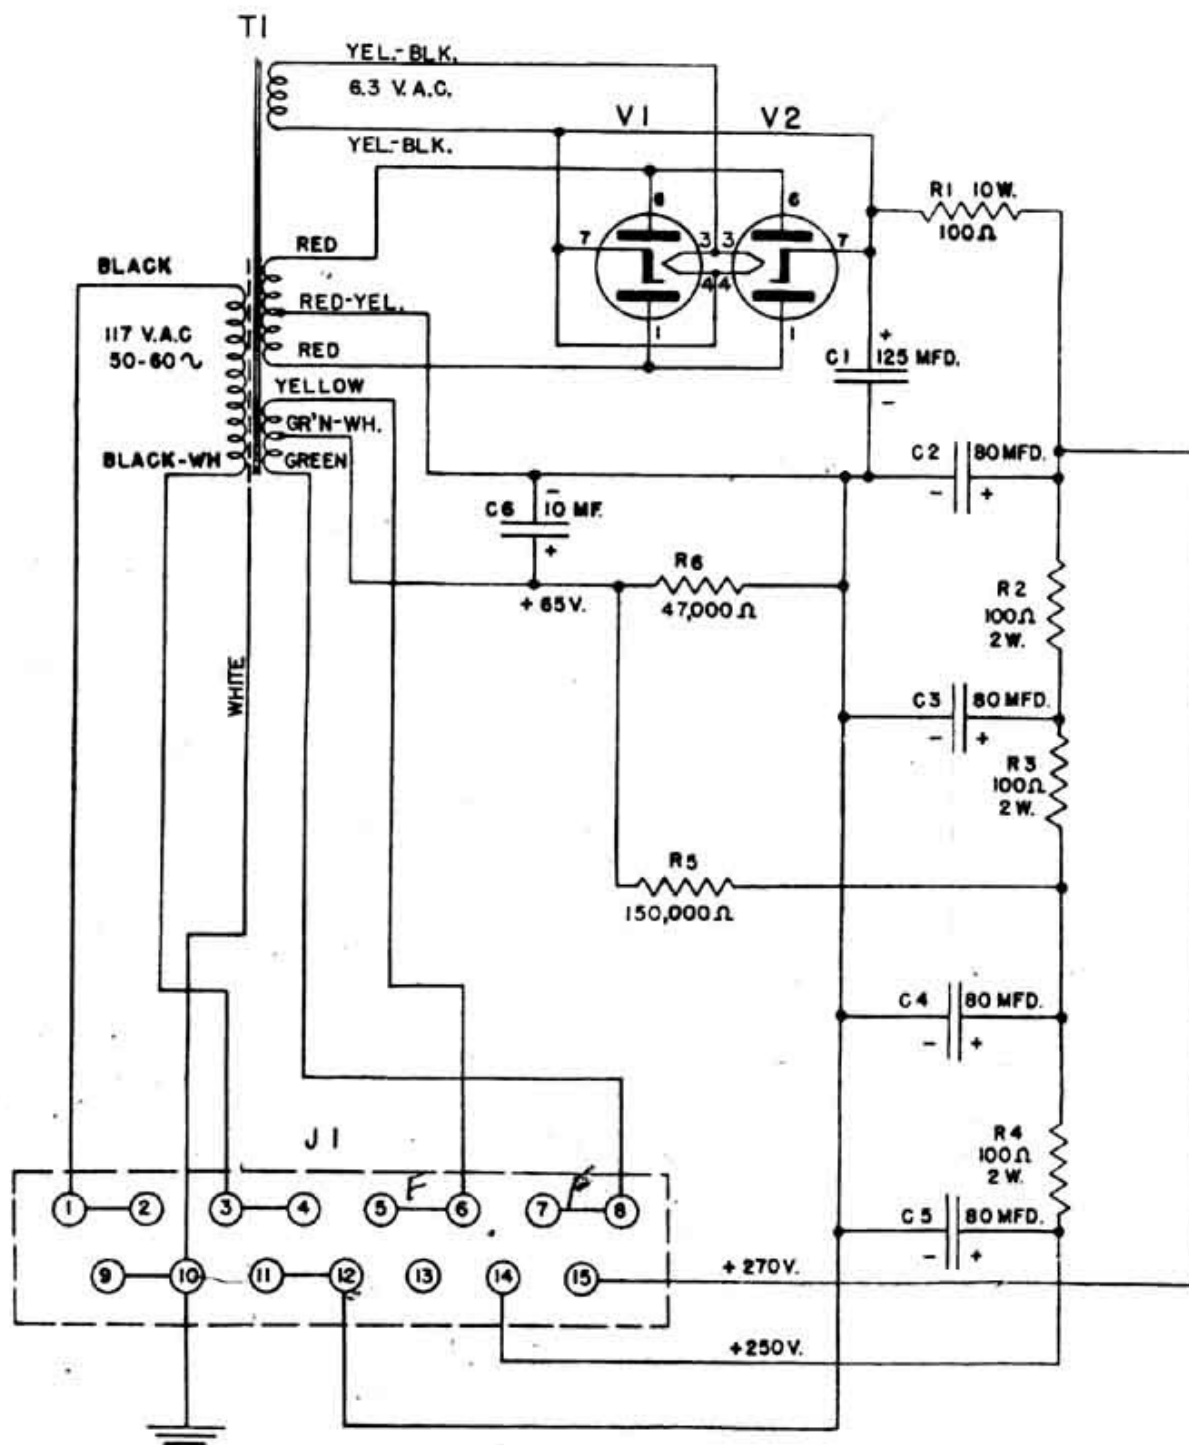

ALTEC LANSING P522B POWER SUPPLY

PARTS LIST	
V1, 2	6X4
T1	PEERLESS 6001
C1	125 MFD. 350V. MALLORY FP-140
C2,3&C4,5	80X80 MFD. 300V. CD-UP8830
C6	10 MFD. 150V. CD-BR1015
R1	100 OHMS 10W. OHMITE B.D.
R2,3,4	100 " 2 W.
R5	150,000 OHMS 1W.
R6	47,000 " "
J1	CANNON DA-15-34P

J1 PIN CONNECTIONS

- 1,2) 117 V.A.C. 50-60 ~
- 3,4) HEATER
- 5) 6.3 V.A.C. AT 4.5 AMP
- 6) HEATER
- 7) CHASSIS GROUND
- 8) CIRCUIT GROUND
- 9) +250 V. AT 65 MA. MAX. CONDITION 1 *
- 10) +270 V. AT 75 MA. MAX. CONDITION 2 *
- 11) +270 V. AT 135 MA. MAX. —
- 12) —

* CONNECTED LOAD 135 MA. MAX.